

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

Four Corners.

FOR CORNERS OF—:	LOCATED IN—:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> N. R. <u>11</u> E. W.	L-5 C-5 B-5 C-4
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on 7-16 & 10-11 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- Corners set by Francis Coleman, D.S. in 1851.
- L-5 $\frac{1}{4}$ Cor. bet. Secs. 12-13. Bearings were: Hem 9, N46°E, 27 lks & W. Birch 10, S38°W, 26 lks.
 - C-5 Sec. Cor. 7-8-17-18. " " Spruce 6, N43°W, 22lks & Spruce 8, S50°E, 24 lks.
 - B-5 $\frac{1}{4}$ Cor. bet. Secs. 7-18. " " Cedar 10, N55°E, 12 lks & Fir 7, S31°W, 24 lks.
 - C-4 $\frac{1}{4}$ Cor. bet. Secs. 7-8. " " Fir 6, N53°E, 35 lks & Fir 8, S66°W, 19 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- L-5 Re-established corner at an old wood post. Found no evidence of original corner.
- C-5 Replaced Cor. by extending line thru two original Cedar Line Trees, 805.2' and 2059.2' West of Corner. Found a Tamarack stump blazed, N70°E, 17.0' From Corner.
- B-5 Replaced Cor. by extending line thru two Cedar line trees, to East of Corner. Found small stream, 25 lks. East of corner as record indicates. No evidence of Cedar Witness identified.
- C-4 Re-established corner midway and on line bet. two Sec. Corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminium cap at all corners.
- L-5 New Bearings: 10" Spruce, N10°E, 26.4' & 8" W. Pine, N69°W, 45.2'
 - C-5 New Bearings: 14" Cedar, N46°W, 38.7' & Scribed 4" Balsam at corner.
 - B-5 New Bearings: 12" Cedar, S70°W, 31.7' & 14" Cedar, S20°E, 29.4'.
 - C-4 New Bearings: W. Pine Cluster, N45°W, 55.3' and 16" Tamarack, N8°W, 61.1'

SIGNED BY Billy D. Buckler DATE 10-30-74
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

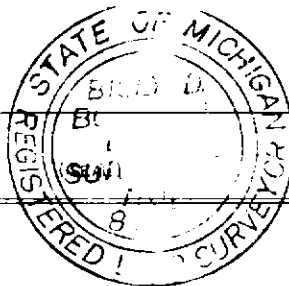

FOR STATE AND UNITED STATES AGENCIES:
 SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____