


**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Luce	Located In:	Corner Code #
<small>(County)</small>		
1. Public Land Survey	T <u>46NR</u> <u>11W</u>	<u>H3</u>
	T <u>    </u> <u>    </u>	<u>    </u>
	T <u>    </u> <u>    </u>	<u>    </u>
	T <u>    </u> <u>    </u>	<u>    </u>
2. Property Controlling in Section	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

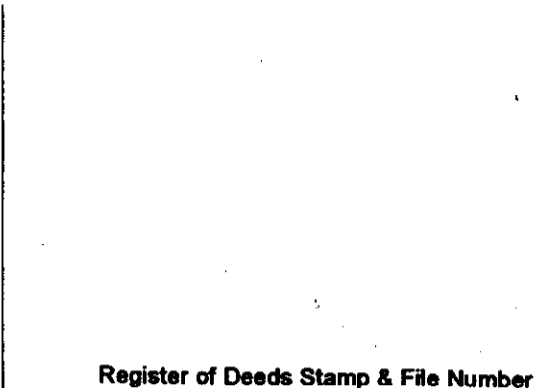

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Oct 21 2002

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 20\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3								●					
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:  
 (H3) Quarter corner common to Sections 3-10. 1851- Established by Francis Colman: S 89 deg. 34'E corr. btwn secs 3 & 10...39.625 Set qr sec. post top of hill 30 ft. Beech 7 N77W 25, Beech 5 S52E 32. ...79.25 Sec. cor. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 (H3) The original post and accessories were not recovered. Found no evidence of subsequent monumentation on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2630.66' east and west. I observed that the mean true bearing of this line is S89 deg. 47' 02" E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H3) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Blazed, scribed, and set measuring nails in:  
 6" Maple N40W 8.85'                      "1/4S NBT"  
 12" Maple S32W 20.2'                      do  
 5" Maple N63E 6.15'                      do  
 8" Maple S24E 25.65'                      do  
 Set a cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.



Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 12/10/02