

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970**

**Luce Co.**

**2 Corners.**

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> N. S., R. <u>12</u> X. W.	<u>H-13, I-8</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-23 & 4-22, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- H-13** Quarter Corner on Southside of Section 34, set by Wm A. Burt, D.S. in 1841.  
Bearings were: Tamarack 5, N48°E, 11 lks. and Tamarack 5, N41°W, 37 lks.
- I-8** Quarter Corner between Sec's. 22-23, set by Francis Coleman, D.S. in 1851.  
Bearings were: Hemlock 10, S4°E, 34 lks. and Hemlock 12", S56°W, 18 lks.


**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- H-13** Replaced corner from original Tamarack witness, N48°E, 7.26'. Found stump with lower face, scribe marks and notch covered with calloused overgrowth.
- I-8** Corner restored by proportionate measure between two Section Corners.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Placed 1" pipe with 4" aluminium cap at both corners.
- H-13** New Bearings: 6" Cedar, N72°E, 10.7' and 6" Cedar, N10°W, 5.1' and  
14" Cedar, S66°W, 16.2' and 6" Cedar, S10°E, 8.6'
  - I-8** New Bearings: 10" W. Pine, S83°E, 24.0' and 8" W. Pine, N52°W, 19.9'.

SIGNED BY Billy D. Buckler DATE 9-11-78  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

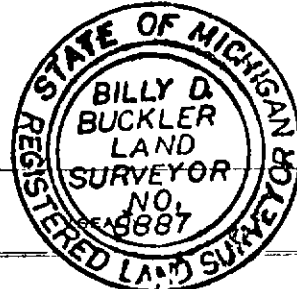

**FOR STATE AND UNITED STATES AGENCIES:**

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_