

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

2 Corners.

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|--|--|--------------------|
| 1. PUBLIC LAND SURVEY _____ | T. <u>46</u> N. <u>12</u> W. <u>12</u> E. | <u>K-5, K-4</u> |
| 2. PROPERTY CONTROLLING IN SECTION _____ | T. _____ N. _____ E. _____ S., R. _____ W. | _____ |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | T. _____ N. _____ E. _____ S., R. _____ W. | _____ |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-3, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

K-5 Section Corner common to Sec's. 11-12-13-14, set by Francis Coleman, D.S. in 1851. Bearings were: Maple 12, N35°W, 36 lks. and Maple 9, S61°E, 9 lks.

K-4 Quarter Corner between Sec's. 11-12, set by Francis Coleman, D.S. in 1851. Bearings were: Beech 12, N42°E, 30 lks. and Beech 10, S19°W, 13 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

K-5 Restored corner by proportionate measure from corners; ½ mile East, ½ mile North, one mile West and to swamp edge to South. Found no evidence of original Corner.

K-4 Placed corner at wood post on old blazed line. Found no evidence of original Corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at both corners.


K-5 New Bearings: Twin S. Maple, S50°W, 32.8' and 8" S. Maple, N2°W, 28.9'.

K-4 New Bearings: 10" Hemlock, S3°W, 26.7' and 12" Hemlock, N56°E, 46.8'.

SIGNED BY _____ DATE 9-11-78

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

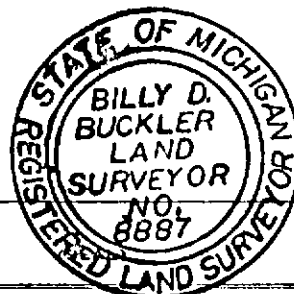

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____