

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

2 Corners

Luce Co.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>46</u> N. S., R. <u>12</u> E. ^X W.	H-7, I-7
2. PROPERTY CONTROLLING IN SECTION	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-24, 19 80, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Francis Coleman, D.S. in 1851. Bearings were:
 Quarter Corner bet. Sec's. 15-22.
 H-7 Cedar 11", N39°W, 28 lks. and Cedar 14", S33°E, 07 lks.
 Section Corner 14-15-22-23
 I-7 Beech 9", N39 W, 15 lks. and Fir 6", S50°E, 19 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

H-7 Computed $\frac{1}{2}$ corner position to fall on East bank of river, between two section corners. Re-witnessed corner as found.
 I-7 Restored corner by D.P.M. from corners in North, West, South directions and swamp edges to East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-7 Found $\frac{3}{4}$ " iron set by Mears Engineering. Marked new witnesses:
 14" Dead Cedar, S65°E, 30.5' and 15" Twin Cedar, S10°W, 67.0'.
 I-7 Rewitnessed corner, a $\frac{3}{4}$ " iron set by Mears Engineering, based on control by this office. Witnessed Corner:
 15" Oak, S63°W, 35.9' and 6" Soft Maple, in clump, N78 W, 1.6'.

SIGNED BY Billy D. Buckler DATE 7-14-80
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

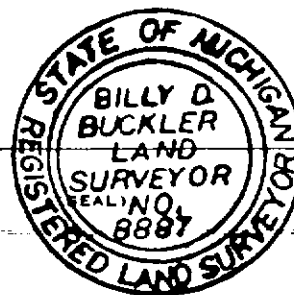

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____