

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Luce</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>46N</u> R <u>12N</u>	<u>E3</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Sep 22 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3				●								
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:
 (E3) Corner common to Sections 4-5-8-9. 1851: Established by Francis Colman. Set post. W.Pine 8 N26E 62 links, W.Pine 12 S57W 20 links. 1952: Remonumented by Dean C. DeLaMater by double proportionate measurement. "One probable original BT still in place, badly burned". Set 1" pipe with 4" brass cap. 10" W.Pine Stump S38W 46 links, 14" W.Pine Stump N58E 102 links. I infer from the 1952 record that the proportionate position fell at GLO record bearing and distance from the "probable original BT". Found no record which of the two original BTs was thought to have been recovered in 1952.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E3) The 1952 monument was not recovered. Remonumented the corner at record bearing and distance from the remains of the 1952 NBT stumps, the 14" stump now badly burned, the 10" stump in good condition, and at record bearing and distance from the stump bottom remains of a White Pine, probably that noted in the 1952 as being "probable original", N26E 62 links, no markings visible. The OBT W.Pine SW was not recovered.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E3) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Set measuring nails in:
 5" J.Pine S79E 16.55' wrkd "S9 NBT"
 10" R.Pine S10W 37.85' "S8 NBT"
 12" R.Pine S24W 52.8' "S8 NBT"
 16" R.Pine S45W 53.2' "S8 NBT"
 Bearings are magnetic. Distances are to nail with tag.

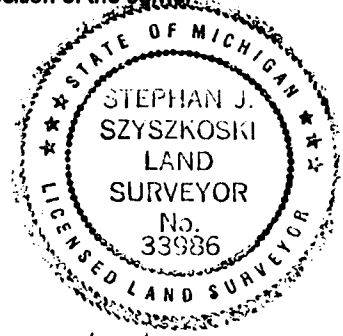

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/15/05