

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Luce	Located In:	Corner Code #
(County)		
1. Public Land Survey	T 47N R 9W	H11
	T 47N R 9W	G11
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____


4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

04/03/2008

I, Stephan J. Szyszkoski, in a field survey on 04/03/2008 do hereby state

that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

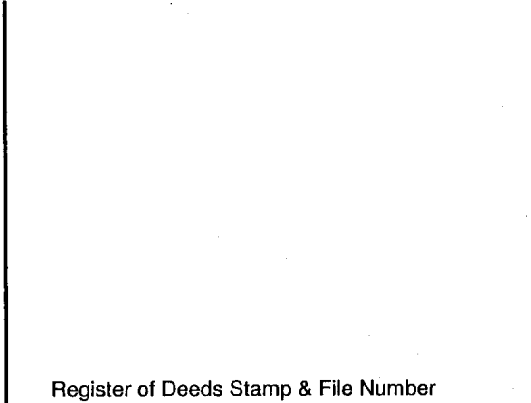

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(H11) Quarter corner common to Sections 27 and 34. 1965 - Frank J. Bray RLS reestablished the corner midway and on line between Section corners. Set 1" Iron pipe with 4" aluminum cap. 7" J.Pine S62W 78 links, 4" Tamarack S46E 41 links.

(G11) Corner common to Sections 27-28-33-34. 1963 - Reestablished by Billy D. Buckler RLS by double proportionate measurement between corners 3 miles west, 2.5 miles east, 1.5 miles north and 1 mile south. Set 1" pipe with 4" aluminum cap. 5" Tamarack N35E 09 links, 5" Tamarack S30E 15 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H11) Recovered the 1965 monument in good condition and at record bearing and distance from the 1965 accessories, now both stumps. Found the position of the monument to be substantially at the midway position of record and accepted same as a careful and faithful reestablishment of the position of the original corner.

(G11) Recovered the 1963 monument in good condition and at record bearing and distance from the 1963 witnesses, both in good condition. Left the monument in place and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H11) Fd. 1"ID I.pipe with 4" alum. MI Dept. of Conservation cap. Set measuring nail with MDNR tag in the side of:
 5" Tamarack S55E 22.9' mkrd "1/4S NBT"
 7" Tamarack S65W 34.1' do
 5" Tamarack N72W 44.85' do
 6" Tamarack N36W 12.1' do
 Bearings are magnetic.

(G11) Fd. 1"ID I.pipe with 4" alum. MI Dept. of Conservation cap. Set measuring nail with MDNR tag in the side of:
 7" Tamrack N40E 6.3' mrkd "S27" 1963 NBT
 9" Tamarack S26E 10.25' "S34" do
 6" Tamarack N12W 4.4' mrkd "S28 NBT"
 8" Tamarack S66E 20.9' "S34 NBT"
 Bearings are magnetic.

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 04/09/2008

For the Michigan Department of Natural Resources, Office of Land and Facilities

