


LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Luce	Located In:	Corner Code #
(County)		
1. Public Land Survey	T _____ R _____	_____
	T 47N R 9W	113
	T _____ R _____	_____
2. Property Controlling in Section	S 34 T 47N R 9W	10
	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

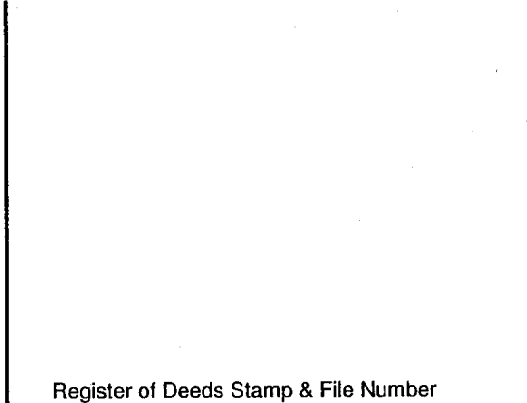

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Stephan J. Szyszkoski, in a field survey on 03/22/2008 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(10-Sec. 34) South 1/16 corner between Sections 33 and 34. Not established in the original survey.

(I13) Corner common to Sections 34-35 T47N-R09W and Sections 2-3 T46N-R09W. 1961 - Remonumented by Billy D. Buckler RLS "from old wood post and old wood point which are in proper position from chopped out cedar to SE and badly decayed tamarack stumps to NW, NE & SW which may have been BTs". Set 1" iron pipe with 4" brass cap. 9" Cedar N54W 28 links, 8" Cedar N49E 25 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(10-Sec. 34) Established the corner midway and on the Section line between Section corner 1318.43' south and Quarter corner 1318.43' north.

(I13) Found the 1961 monument in good condition, positioned over an old post point, and at record bearing and distance from the 9" Cedar NBT NW, now a stump with measuring notch visible. The Cedar NBT NE was not recovered. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(10) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 6" Tamarack N45E 17.6' mrkd "S1/16 BT"
 4" Balsam N48W 19.06' do
 6" W.Birch S22W 29.85' do
 3" Balsam S80E 20.45' do
 Bearings are magnetic.

(I13) Found 1"ID I.pipe with 4" brass MI Dept. of Conservation cap. Set measuring nail with MDNR tag in the side of:
 8" W.Birch S59E 23.25' mrkd "S2 NBT"
 11" Cedar S73W 31.35' "S3 NBT"
 12" Tamarack N13W 42.05' "S34 NBT"
 13" Tamarack N19E 40.55' "S33 NBT"
 Bearings are magnetic.

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 04/09/2008



For the Michigan Department of Natural Resources, Office of Land and Facilities