

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Lace Co. 2 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. <u>47</u> N. <u>X</u> , R. <u>10</u> W.		<u>C-12, E-12</u>
2. PROPERTY CONTROLLING IN SECTION _____, T. _____ N. _____ S., R. _____ E. _____ W.		
3. MISCELLANEOUS PROPERTY IN SECTION _____, T. _____ N. _____ S., R. _____ E. _____ W.		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7/7/76 & 1/28/77, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

C-12 Quarter Corner between Sec's. 31-32, set by Geo. H. Cannon D.S. while making a corrected survey of twp. in 1853.
 Bearings were: Sugar 20, S38°W, 47 lks. and Sugar 14, N25°E, 35 lks.

E-12 Quarter Corner between Sec's. 32-33, set by Geo. H. Cannon D.S. while making a corrected survey of twp. in 1853.
 Bearings were: Beech 12, S85°E, 49 lks. and Beech 13, S39°W, 26 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-12 Corner first restored on May 12, 1960 by Frank J. Bray R.L.S. Since has been removed by road construction. Now re-monumented midway and on line with E.A. Sainio, R.L.S.

E-12 Corner restored midway and on line between two Section Corners. Found no evidence of original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-12 Placed 24" "T" Iron at corner.
 New Bearings: 5" B. cherry, N65°W, 41.4' and Power Pole, N56°W, 70.1'
 Alignment of road to North is 26.0' East of Corner. Road to West is North of the Quarter Line.

E-12 Placed 1" pipe with 4" aluminium cap at corner.
 New Bearings: 8" R. Maple, S75°W, 5.2' and 8" Twin R. Maple, S35°E, 14.0'.

SIGNED BY *Billy D. Buckler*
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 9-14-78

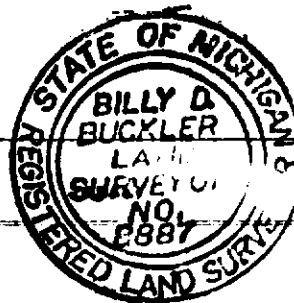

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____