

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

Five Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>47</u> N. <del>X</del> R. <u>10</u> E. W.	C-9, B-9, D-9 <u>1, Sec. 29</u>
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. S. R. _____ E. W.	<u>3, Sec. 29</u>
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____	RECORDED PLAT _____	_____
5. PRIVATE CLAIMS _____	_____	_____

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-4, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**Corners placed by Geo. H. Cannon D.S. in 1853.**

- C-9 Sec. Cor. 19-20-29-30. Bearings were: Beech 7, N79°W, 24 lks. & Beech 10, S5°E, 40 lks.
- B-9 ¼ Cor. bet. Sec's. 19-30 " " Sugar 14, S50°E, 29 lks. & Sugar 16, N30°E, 6 lks.
- 1, Sec. 29 West 1/16 Cor. bet. Sec's. 20-29.
- D-9 ¼ Cor. bet. 20-29. Bearings were: Beech 9, N38°W, 35 lks. & Beech 9, S58°E, 5 lks.
- 3, Sec. 29 North 1/16 Corner bet. Sec's. 29-30.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**


- C-9 Placed corner by proportionate measure from corner to East and West and in line with old fences. Corner lies in East edge of old road bed.
- B-9 Replaced corner at an old wood post, believed set by H. Lawrence, R.L.S. Found no original evidence.
- 1, Sec. 29 Placed corner midway and on line bet. Sec. Cor. to West and ¼ Cor. to East.
- D-9 Re-established corner midway and on line bet two Sec. Cors.
- 3, Sec. 29 Placed corner midway and on line bet. Sec. Cor. to North and ¼ Cor to South.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- C-9 Placed 3/4" x 32" pipe. New Bearings: 8" Maple, N61°E, 77.8' and 10" Maple clump, S62°W, 47.2'
- Placed 1" pipe with 4" Dep't cap at rest of corners.
- B-9 New Bearings: 28" W. Pine, N53°W, 34.5' and 12" Spruce, S55°E, 12.6'
- 1, Sec. 29 Bearings: 12" maple, N17°E, 17.3' and 8" S. Maple, S51°E, 21.4'
- D-9 New Bearings: 6" Maple, S53°E, 52.5' and 8" Maple, N16°E, 17.8'
- 3, Sec. 29 Bearings: 6" J. Pine, S3°W, 78.3' and 8" R. Pine, N73°W, 95.1'

SIGNED BY Billy D. Buckler DATE 8-25-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

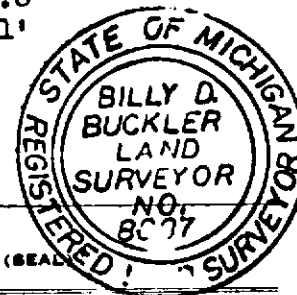

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_