

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

3 Corners.

FOR CORNERS OF --	LOCATED IN --	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>47</u> N. R. <u>10</u> E.	<u>J-11 & I-13</u>
2. PROPERTY CONTROLLING IN SECTION <u>34</u>	T. <u>47</u> N. R. <u>10</u> E.	<u>16-Sec.34</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. R. _____ E.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 4-28 & 4-30, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- J-11** Quarter Corner bet. Sec's. 26-35, set by Geo H. Cannon, D.S. in 1853. Bearings were: Cedar 10", S38°E, 16 lks. and Tamarack 10", N55°E, 11 lks.
- I-13** Sec. Cor., 34-35, T47N R10W and 2-3, T46N R10W. Record dated, 1-29-75.
- 16-Sec.34** East 1/16 Corner on South side of Section 34.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- J-11** Placed corner from remains of both witnesses. Cedar down, poor condition; Tamarack stump bottom in proper position. No evidence of use.
- I-13** Drove 36" T-Iron in North edge of blacktop road.
- 16-Sec.34** Drove 36" T-Iron in North edge of blacktop road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- J-11** Placed 1" pipe with 4" alum. cap at corner. New Bearings: 5" W. Pine, NE, 49.6' & 12" W. Pine, NE, 50.9'.
- I-13** Marked New Bearings: 10" W. Pine, N19°E, 78.4' & 12" W. Pine, S34°E, 70.9'.
1975 Bearings: Power Pole, N27°W, 33.9' & 1 1/2" pipe, S47°E, 61.7'.
- 16-Sec.34** Marked New Bearings: 16" W. Birch, N8°E, 60.8'.
1975 Bearings: 10" W. Birch, N20°W, 62.8'.

SIGNED BY Billy D. Buckler DATE 4-81
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

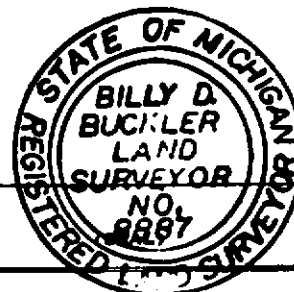

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____