

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Luce

(County)

Located In: Corner Code #

- | | | |
|------------------------------------|---------------------------|------------|
| 1. Public Land Survey | T <u>47N</u> R <u>10W</u> | <u>I11</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jan 22 2002

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11									●				
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(I11) Corner common to Sections 26-27-34-35. Remonumented in 1957 by Billy D. Buckler, RLS: Replaced section corner from one cedar B.T. in excellent condition (green) bearing N59W 10.5 links. Found no evidence of use. 1" pipe with 4" brass cap. 8" Cedar N32E 35 links, 7" Cedar S44E 35 links, 12" W.Pine S9W 69 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I11) Recovered the 1957 monument in good condition, at record bearing and distance from the 1957 witnesses recovered as follows: Cedar NE in good condition, Cedar SE a stump with blaze visible, W.Pine SW dead and down. Left the monument in place and made new witnesses as described below. The original BT noted in the 1957 record has now rotted away.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(I11) Found 1" ID I.pipe with 4" brass MI Dept. of Conservation cap. Blazed, scribed, and set measuring nails in:
 9" Cedar N37E 23.3' "S26"
 7" Cedar N31E 14.05' "S26 NBT"
 5" Cedar N46W 11.4' "S27 NBT"
 7" Cedar S42E 13.85' "S35 NBT"
 Bearings are magnetic. Distances are to nail with tag.

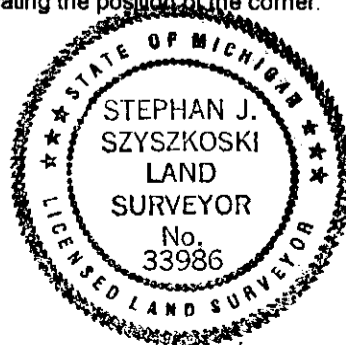

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/6/02