

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Luce Co. Three Corners.

FOR CORNERS OF -:	LOCATED IN -:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>47</u> N. <u>8</u> , R. <u>11</u> <input checked="" type="checkbox"/> W.	K-7 L-7 2-Sec. 24
2. PROPERTY CONTROLLING IN SECTION <u>24</u>	T. <u>47</u> N. <u>8</u> , R. <u>11</u> <input checked="" type="checkbox"/> W.	
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		


REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 12-3 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:**
- K-7 Sec. Cor. 13-14-23-24, Set by Geo. H. Cannon, D.S. 1853.
Bearings were: Sugar 11", N5°E, 72 lks. and Hemlock 12", S38°E, 26 lks.
 - L-7 $\frac{1}{4}$ Cor. bet. Sec's. 13-24, set by Geo. H. Cannon, D.S. 1853.
Bearings were: Balsam 6", N81°W, 52 lks. and Beech 8", S40°E, 5 lks.
 - 2-Sec. 24 East 1/16 Corner, on Northside, Section 24.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**
- K-7 Corner replaced at an old wood post, set by unknown surveyor. Location checks with corners, $\frac{1}{2}$ mile to North and South, and is at record distance from Corner, 1 mile East.
 - L-7 Corner re-established midway and on line bet. two Sec. Corners - No evidence of original corner.
 - 2-Sec. 24 Corner placed midway bet. Sec. Cor. to East and $\frac{1}{4}$ Cor. to West.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**
- Placed 1" pipes and 4" aluminium caps at all corners.
- K-7 New Bearings: 6" W. Pine, N63°W, 58.6' and 11" W. Pine, S27°W, 73.3'
 - L-7 New Bearings: 8" W. Pine, S29°E, 6.9' and 10" W. Pine, S42°W, 7.1'
 - 2-Sec. 24 New Bearings: 10" H. Maple, N63°E, 8.7' and 8" H. Maple, N87°W, 19.1'

SIGNED BY Billy D. Buckler DATE 2-5-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

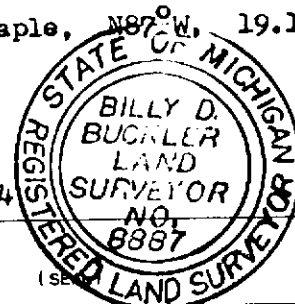

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR