

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

Three Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 42 N. R. 8 E.	E-11, D-11, E-10
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E.	
4. LOT NO. _____ RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram-over) were, in a field survey on 2-13 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Wells Burt D.S. in 1850.

- | | | | | |
|------|--|--------------|--------|---------|
| E-11 | Sec. Cor., 28-29-32-33, Bearings were: | W. Birch 14" | S68°W, | 14 lks. |
| | | W. Pine 18" | N75°E, | 29 lks. |
| D-11 | Cor., bet. Secs. 29-32, | Hemlock 12" | N31°E, | 15 lks. |
| | | Sugar 8" | S56°W, | 9 lks. |
| E-10 | Cor., bet. Secs. 28-29, | Hemlock 18" | N45°E, | 28 lks. |
| | | Maple 12" | S36°W, | 9 lks. |

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-11 Replaced corner from a W. Pine B.T. in excellent condition. Found wood post, on ground.
- D-11 Re-established corner midway and on line bet. two Sec. Cors.
- E-10 Replaced corner from Hemlock B.T., badly rotted and down. No evidence of use at corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pine with 4" dept. cap at all corners.

- E-11 New Bearings: 9" Cedar, N64°E, 22.5' and 7" Cedar, S83°W, 23.6'
- D-11 New Bearings: 28" W. Pine, S50°W, 51.4' and 9" E. Maple, S52°E, 41.7'
- E-10 New Bearings: 12" Cedar, N71°E, 39.1' and 18" W. Pine, N1°W, 33.4'

SIGNED BY Billy D. Buckler DATE 9-26-73

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

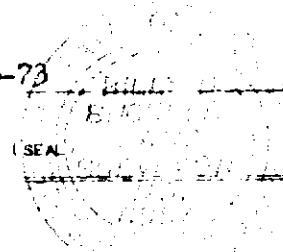

FOR STATE AND UNITED STATES AGENCIES:
SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR