

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

Three Corners.

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|--------------------------------------------|-------------------------------------------------------------------------------------|--------------------|
| 1. PUBLIC LAND SURVEY _____ | T. <u>48</u> ^{N.} S. , R. <u>10</u> ^{E.} W. | C-11, C-10, D-9 |
| 2. PROPERTY CONTROLLING IN SECTION _____ | , T. _____ S., R. _____ E. _____ W. | _____ |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | , T. _____ S., R. _____ E. _____ W. | _____ |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 11-7 & 3-12 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Geo. H. Cannon, D.S. in 1853.

- C-11 Sec. Cor. 29-30-31-32, Bearings were: Cedar 11", West, 13 lks. & Tamarack 18", N77°E, 16½ lks.
- C-10 Quarter Corner bet. Sec's 29-30. Bearings were: Cedar 9", N44°E, 19 lks & Cedar 11", S67°W, 15 lks.
- D-9 Quarter Corner bet. Sec's 20-29. Bearings were: Hemlock 14", S57°E, 22 lks. Spruce 10", N83°W, 13 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-11 Re-established corner, using an original Line Tree and ¼ Cor. to East. Position checks well with corners 1 mile North and 1 mile South. Found no evidence of original corner. May have been removed in road construction.
- C-10 Re-established corner, midway and on line bet. two Sec. Cors. Found no evidence of original corner. Found original line tree to North.
- D-9 Corner re-established midway and on line bet two Sec. Cors.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Placed 1" pipe with 4" aluminium cap at all corners.

- C-11 New Bearings: 6" B. Spruce, S33°W, 30.8' and 10" W. Birch, N25°W, 15.2'
- C-10 New Bearings: 6" Spruce, S28°W, 9.6' and 6" Spruce, N64°E, 14.3'
- D-9 New Bearings: 14" W. Pine, N2°W, 41.8' and 10" W. Pine, S53°E, 22.2'

SIGNED BY *Billy D. Buckler*
Billy D. Buckler

DATE 4-7-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

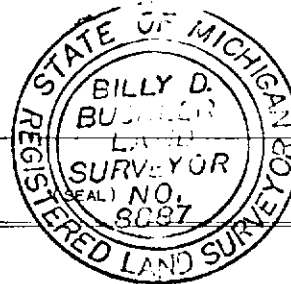

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____