

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

Three Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>48</u> ^{N.} X. , R. <u>11</u> ^{X.} W.	F-7, E-6, E-5
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ ^{N.} S. , R. _____ ^{E.} W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} S. , R. _____ ^{E.} W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 8/5 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 Corners placed by Geo. H. Cannon, D.S. during a correctional survey of twp. in 1853.
 F-7 $\frac{1}{4}$ Corner bet. Sec's: 16-21. Bearings were: Cedar 7", N23°E, 11 lks. and Cedar 9", N88°W, 13 lks.
 E-6 $\frac{1}{4}$ Corner bet Sec's: 16-17. Bearings were: Spruce 5", S78°E, 13 lks. and Spruce 9", N68°W, 10 lks.
 E-5 Sec. Cor. 8-9-16-17. Bearings were: Tamarack 7", S47°E, 33 lks. and Tamarack 8", N50°W, 9 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 F-7 Corner re-established on West bank of River, as indicated in record. Location determined by proportionate measure bet. Sec. Cor. to West and a Y. Birch line tree to East.
 E-6 Corner replaced at wood post, found a W. Pine line tree 9.51 chains South as indicated in record.
 E-5 Corner replaced at a wood post, found remains of a tamarack witness to Northwest.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Placed 1" pipe with 4" aluminium cap at all corners.

F-7 New Bearings: 12" Hemlock, N63°W, 28.0' and 16" Cedar, S63°W, 23.3'
 E-6 New Bearings: 12" Cedar, S29°E, 23.2' and 10" Cedar, S80°W, 12.5'
 E-5 New Bearings: 5" Spruce, S27°W, 32.6' and 6" Tamarack, N19°W, 23.3'

SIGNED BY Billy D. Buckler DATE 8/22/74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

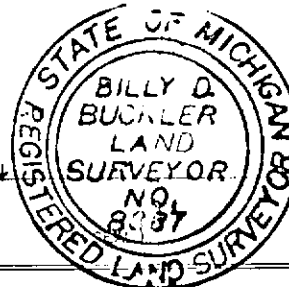

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____