

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

2 Corners

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>48</u> N. <u>X</u> , R. <u>11</u> W.	A-1, C-1
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-11-80 & 6-5-79, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

A-1 Sec. Cor. for Sec. 6, T48N R11W; Sec. 1, T48N R12W; Sec. 31, T49N R11W; and Sec. 36, T49N R12W. Also a Township Corner, set by Wm A. Burt, D.S. in 1841. Bearings were: Birch 28", S23°W, 28 lks. and Fir 9", N32°E, 19 lks.

C-1 Sec. Cor. for Sec's. 5-6, T48N R11W and Sec's. 31-32, T49N R11W, set by John Burt, D.S. in 1841. Bearings were: Maple 5", N15°E, 20 lks. and Beech 10", N35°W, 28 lks. 1853 bearings by Geo. H. Cannon, D.S. were: Balsam 8", S55°W, 14½ lks. and Y. Birch 14", S65°E, 28 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

A-1 Restored monument to proper position as set by myself 6-17-58. 2" Iron Pipe set by Marcus Schaaf, R.L.S. in place. Monument removed by a logging operation. Found original Y. Birch still green and a Hemlock marked but not recorded still green, bearing S69°E, 36½ lks. Hemlock 10" when marked now 26".


C-1 Restored corner location. Found 1" pipe with cap and a 2" pipe with concrete at edge of road. Both have been removed by logging traffic.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-1 Replaced the 1" pipe with 4" Erass cap at corner, the 1958 bearings are all in good condition marks now grown over. Hard Maple 11", S11°E, 23 lks. and 14" H. Maple, N73°W, 44 lks. and S. Maple, 14", N18°E, 35 lks.

C-1 Buried a 36" "T" Iron in firelane intersection. Bearings marked 6-10-58 still in good condition. W. Pine 13", N46°W, 46 lks. & W. Pine 15", S7°E, 31 lks. & W. Pine 13", N40°E, 57½ lks.

SIGNED BY _____ DATE 10-9-80
Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

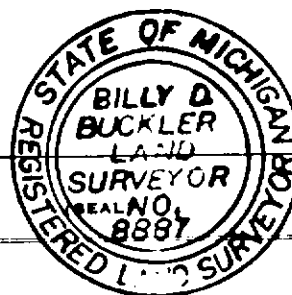

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET