

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

3 Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>48</u> N. <u>X</u> , R. <u>11</u> W. <u>X</u>	E-1
2. PROPERTY CONTROLLING IN SECTION <u>6</u>	T. <u>48</u> N. <u>X</u> , R. <u>11</u> W. <u>X</u>	3-Sec. 6, 6-Sec. 6
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-11, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 E-1 Sec. Cor. for Sec's. 4-5, T48N R11W and Sec's. 32-33, T49N R11W, set by John Burt, D.S. in 1841. Corner monumented by myself, 6-25-57.

3-Sec. 6 North 1/16 Corner on West side of Sec. 6.

6-Sec. 6 North-East 1/16 Corner of Sec. 6.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 E-1 Replaced corner which was removed by logging traffic. Found remains of a concrete block 2' deep in soil.

3-Sec. 6 Placed corner at wood post, set by John McClaren, CCI Forester:

6-Sec. 6 Placed corner, 1,298.8' South of the Sec. Line and parallel with the West Sec. Line. Found blazes but no post.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Placed 1" pipe with 4" aluminum cap at all three corners.

E-1 Bearings marked 6-25-57 are all in good condition: 12" W. Pine, N27°W, 64½ lks. and 10" W. Pine, S40°E, 68 lks. and 11" W. Pine, N55°E, 96 lks.

3-Sec. 6 14" W. Pine, S55°W, 10.1' & 14" W. Pine, N47°E, 12.6'. Corner lies 100' North of an open marsh.

6-Sec. 6 14" S. Maple, S11°E, 24.6' and 13" S. Maple, S36°W, 28.5'.

SIGNED BY _____ DATE 10-9-80
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

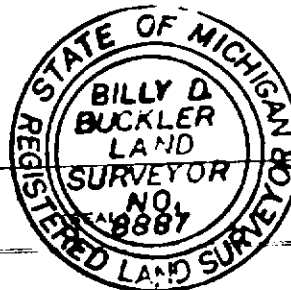

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET