

#30

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Luca

(County)

Located In:

Corner Code #

1. Public Land Survey

T 49N R 8W 65  
T R  
T R  
T R

2. Property Controlling  
in Section

S 10 T 49N R 8W 15

3. Miscellaneous  
Property in Sec.

S T R  
S T R  
S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Nov 08 1995

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

- (65) Corner common to Sections 9-10-15-16. Corner re-monumented in 1952 by Dean C. DeLaMater, RLS: "This corner was pointed out to me by B. McTiver, District forester, of Newberry. One original B.T. in place, down, fair condition. Placed 1" pipe with 4" Brass cap. 14" W. Pine N25E 108 links, 10" W. Pine S42W 75 links".
- (15-Sec. 10) West 1/16 corner between sections 10-15. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (65) Found and accepted the 1952 monument, as described, in good condition, and at record bearing and distance from the remaining W. Pine NBT N25E, now a 24" tree in good condition. Left the monument in place and marked a new BN blaze on the 1952 NBT. Marked three new witnesses as described below.
- (15-Sec. 10) Found no evidence of prior monumentation. Established the corner midway and on a straight line between Section corner 1328.52 feet west and 1/4 corner 1328.52 feet east. At the position for the corner, I placed a 1" IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Found a cedar post 1.2' south and 1.5' east of the corner monumented.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(65) Found 1" pipe with 4" brass Mich. Dept. of Conservation cap. Blazed, scribed, and set measuring nails in:  
 24" W. Pine N25E(rec. brg) 69.2' S10"  
 8" W. Pine N48E 14.4' S10 NBT"  
 6" W. Pine S75N 16.15' S16 NBT"  
 6" W. Pine N20W 21.15' S9 NBT"  
 Placed a 5" squared and scribed cedar post adjacent. Bearings are magnetic.

(15) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following bearing trees:  
 4" Beech S10E 13.0' N1/16 BT"  
 8" Hemlock S89E 14.45' N1/16 BT"  
 24" W. Pine N62W 19.5' N1/16 BT"  
 6" Hemlock S70W 7.2' N1/16 BT"  
 Placed a 5" squared and scribed Cedar post adjacent. Bearings are magnetic.

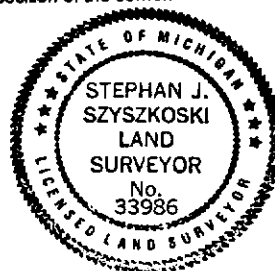

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 2-1-96

For the Michigan Department of Natural Resources - Forest Management Division