

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

6 Corners.


FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>49</u> ^{N.} / _{S.} , R. <u>9</u> ^{E.} / _{W.}	L-11, K-11, K-12 J-1 15-Sec.2 16-Sec.2
2. PROPERTY CONTROLLING IN SECTION <u>2</u>	T. <u>49</u> ^{N.} / _{S.} , R. <u>9</u> ^{E.} / _{W.}	
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} / _{S.} , R. _____ ^{E.} / _{W.}	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-3 & 3-23, 19 76, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- L-11 Quarter Corner bet. Sec's. 25-36, set by Harvey Mellen, D.S. in 1850. Bearings were: W. Pine 20, S11°E, 37 lks. & Y. Pine 18, N9°W, 15 lks.
 - K-11 Sec. Cor. 25-26-35-36, set by Harvey Mellen, D.S. in 1850. Bearings were: Tam 6, S50°W, 21 lks. & Tam 6, N67°E, 55 lks.
 - K-12 Quarter Corner bet. Sec's. 35-36, set by Harvey Mellen, D.S. in 1850. Bearings were: S. Pine 12, S42°E, 21 lks. and S. Pine 14, N52°W, 37 lks.
 - J-1 North 1/4 Corner Sec.2 T49N R9W, set by John Burt, D.S. in 1841. Bearings were: N. Pine 7, S65°E, 13 lks. and N. Pine 6, S42°W, 20 lks.
 - 15-Sec.2 West 1/16 Corner on Southside of Section 2.
 - 16-Sec.2 East 1/16 Corner on Southside of Section 2.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- L-11 Found Y. Pine B.T. down with notch and bottom blaze part of top blaze with scribe marks plain. W. Pine down and badly rotted. Found part of upper face.
 - K-11 Corner re-established by double prop. meas. from corners 1 mile North, 1/2 mile East, 1 mile West, and 1 mile South.
 - K-12 Corner re-established midway and on line bet two section corners.
 - J-1 Re-witnessed corner as recorded by D.C. DeLaMater, R.L.S. 10/27/52. Found both Jackpine witnesses dead. One original witness still in place.
 - 15-Sec.2 Placed corner midway bet 1/4 corner to East and Section corner to West.
 - 16-Sec.2 Placed corner midway bet 1/4 corner to West and Section corner to East.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Placed 1" pipe with Dep't cap at all corners.
- L-11 New Bearings: 16" Red Pine, S34°E, 9.3' and 16" Red Pine, S83°W, 20.2'.
 - K-11 New Bearings: 8" W. Pine, S62°W, 46.0' and 12" W. Pine, S79°E, 67.0'.
 - K-12 New Bearings: 6" W. Pine, N80°E, 21.9' and 10" W. Pine, N72°W, 51.9'.
 - J-1 Re-Witnessed Corner: New Bearings: 20" Red Pine, S45°E, 68.6' and 14" Red Pine, S62°W, 45.7'.
 - 15-Sec.2 Bearings: 10" Red Pine, N84°E, 69.9' and 16" Red Pine, N32°W, 66.1'.
 - 16-Sec.2 Bearings: 10" Red Pine, S38°W, 43.0' and 6" Red Pine, S79°W, 7.4'.

SIGNED BY Billy D. Buckler DATE 1-27-77
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

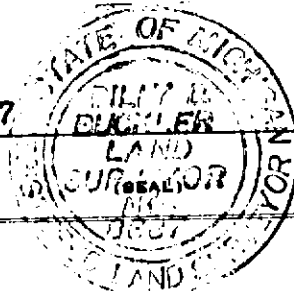

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____