

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

LUCE COUNTY

3 corners

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>49</u> N. <u>9</u> W. <u>9</u>	J-I
2. PROPERTY CONTROLLING IN SECTION <u>2</u>	T. <u>49</u> N. <u>9</u> W. <u>9</u>	I5-SEC. 2
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	I6-SEC. 2
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, RLS, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 3/23/76, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

J-I; North Quarter Corner, Sec. 2, 49-9, set by John Burt, D.S. 1841.
 Bearings were:
 N. Pine 7", S65E, 13 Lks. and N. Pine 6", S42W, 20 Lks.
I5-SEC. 2; West I/I6 Corner, on South side, Sec. 2.
I6-SEC. 2; East I/I6 Corner, on South side, Sec. 2.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


J-I; Re-witnessed Corner as recorded by D. C. De La Mater, RLS 10/27/52. Found both Jackpine witnesses dead. One original witness still in place.
I5-SEC. 2; Placed Corner midway bet. 1/4 Cor. to East and Sec. Cor. to West.
I6-SEC. 2; Placed Corner midway bet. 1/4 cor. to West and Sec. Cor. to East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-I; Re-witnessed Corner. New Bearings:
 20" R. Pine, S45E, 68.6° and 14" R. Pine, S62W, 45.7°.
I5-SEC. 2; Placed 1" Pipe with 4" Aluminum Cap, at Corner.
 Bearings:
 10" R. Pine, N84E, 69.9° and 16" R. Pine, N32W, 66.1°.
I6-SEC. 2; Placed 1" Pipe with 4" Aluminum Cap, at Corner.
 Bearings:
 10" R. Pine, S38W, 43.0° and 6" R. Pine, S79W, 7.4°.

SIGNED BY Billy D. Buckler *Billy D. Buckler* DATE 9/27/76.

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887.

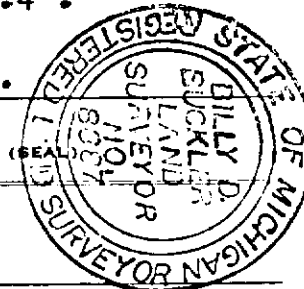

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____