

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Luca

(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|-----------------|----|
| 1. Public Land Survey | T 49N R 9W | K6 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S 13 T 49N R 9W | 8 |
| | S 13 T 49N R 9W | 11 |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Stephan J. Szyszkoski, in a field survey on May 06, 1993, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

A. Description of original monument and accessories and/or subsequent restoration:

- (K6) Quarter corner common to Sections 13-14. Corner previously recorded by Billy D. Buckler RLS, in 1957 as monumented by a 1" pipe with 4" brass cap. 1957 NBTs: 10" W. Pine N34E 11 links, 13" W. Pine S75E 45 links. Found no subsequent record.
(8) West 1/16 corner, Section 13. Corner not established in the original survey. Found no subsequent record.
(11) Southwest 1/16 corner of Section 13. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (K6) found and accepted Buckler's monument as described, at record bearing and distance from the W. Pine NBT N34E, which is in good condition. The second bearing tree has blown over. Marked 3 new bearing trees as described below.
(8) Established the corner midway and on a straight line between 1/4 corner 1326.05' west and Center of Section 1326.05' east, both corners of record. At the position for the corner, I placed a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner established, an old squared post, apparently an approximate corner, was found 0.4' north and 4.8' east.
(11) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. The 1/16 corners N and W being monumented, and those E and S being unmonumented computed positions midway between adjacent 1/4 corners. At the position for the corner I placed a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate/locating the position of the corner:

- | | | |
|--|--|---|
| (K6) Found 1" pipe with 4" brass cap.
Set a measuring nail in the 1957 NBT:
16" W. Pine N34E 7.95'
Blazed, scribed, and set measuring nails in the following new bearing trees:
12" W. Pine West 13.7' "1/4S NBT"
18" W. Pine S42E 3.6' "1/4S NBT"
8" Balsam N34W 24.75' "1/4S NBT"
Placed a 4" W. Birch post adjacent.
Schaff's 1-1/2" pipe is also adjacent. | (8) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails in the following bearing trees:
12" Spruce S82W 9.7' "1/16S BT"
6" Balsam N53W 17.3' "1/16S BT"
12" Balsam N30E 9.0' "1/16S BT"
4" Hemlock S58E 24.95' "1/16S BT"
placed the old post adjacent to the monument. | (11) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails in the following bearing trees:
12" R. Pine N08E 34.4' "1/16S BT"
10" R. Pine N39E 23.6' "1/16S BT"
8" Cedar S15E 34.6' "1/16S BT"
12" W. Pine S52W 19.4' "1/16S BT"
placed a 5" squared cedar post adjacent to the monument. |
|--|--|---|

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

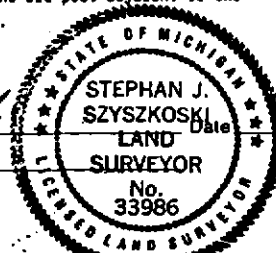

8-4-93