

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Luce</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>11</u> T <u>49N</u> R <u>09W</u>	<u>1</u>
	S <u>11</u> T <u>49N</u> R <u>09W</u>	<u>2</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims		

Register of Deeds Stamp & File Number

I, Stephan J. Szyszkoski, in a field survey on Sept. 27, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3									●	●			
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- (1-Sec. 11) West 1/16 corner between Sections 2 and 11. 1976 - Established by Billy D. Buckler RLS midway and on line between Section and Quarter corners. Set 1" ID I.pipe with 4" alum. MDNR cap. 10" R.Pine N84E 69.9', 16" R.Pine N32W 66.1'.
 - (2-Sec. 11) East 1/16 corner between Sections 2 and 11. 1976 - Established by Billy D. Buckler RLS midway and on the Section line between Quarter and Section corners. Set 1" ID I.pipe with 4" alum. MDNR cap. 10" R.Pine S38W 43.0', 6" R.Pine S79W 7.4'.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- (1-Sec. 11) Recovered the 1976 monument in good condition and at record bearing and distance from the 1976 witnesses, both standing in good condition. The position of the monument is S26E 2.0' from the midpoint position intended by Mr. Buckler and I accept the monument as a careful and faithful establishment of the position of the corner.
 - (2-Sec. 11) Recovered the 1976 monument in good condition and at record bearing and distance from the 1976 witnesses. The record bearing to the 10" R.Pine S38W is in the wrong quadrant and it should have been recorded as S38E. The position of the monument is N63W 4.4' from the midpoint position intended by Mr. Buckler and I accept the monument as a careful and faithful establishment of the position of the corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- (1) Found 1" ID I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 - 18" R.Pine N77E 70.3' mrkd "W1/16" 1976 BT
 - 20" R.Pine N33W 66.45' do do
 - 14" J.Pine N01W 13.52' mrkd "W1/16 BT"
 - 7" J.Pine S18W 9.2' do
 Bearings are magnetic.
 - (2) Found 1" ID I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 - 14" R.Pine S85W 7.58' 1976 BT
 - 15" R.Pine S36E 43.45' do
 - 15" R.Pine S80E 23.39' mrkd "E1/16 BT"
 - 11" J.Pine N44E 28.03' do
 Bearings are magnetic.

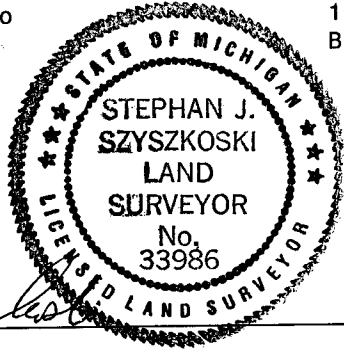

Signed by Stephan J. Szyszkoski Date 10/25/07