

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970
Luce Co. 5 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>49</u> ^{N.} / _{S.} , R. <u>10</u> ^{K.} / _{W.}	<u>8-Sec.4</u> <u>15-Sec.4</u>
2. PROPERTY CONTROLLING IN SECTION <u>4</u>	T. <u>49</u> ^{N.} / _{S.} , R. <u>10</u> ^{X.} / _{W.}	<u>9-Sec.4</u> <u>16-Sec.4</u> <u>9A-Sec.4</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} / _{S.} , R. _____ ^{E.} / _{W.}	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 1/13, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- 8-Sec.4 West 1/16 Corner, Section 4.
- 9-Sec.4 East 1/16 Corner, Section 4.
- 9A-Sec.4 Meander Corner, on East 1/16 line at Lake. (503.4' North of East 1/16 Corner.)
- 15-Sec.4 West 1/16 Corner, on South side, Section 4.
- 16-Sec.4 East 1/16 Corner, on South side, Section 4.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- 8-Sec.4 Placed corner midway bet. West $\frac{1}{4}$ Corner and Center Corner.
- 9-Sec.4 Placed corner midway bet. Center corner and East $\frac{1}{4}$ Corner.
- 9A-Sec.4 Placed corner on East 1/16 line and on South Shore Lake Superior.
- 15-Sec.4 Placed corner midway bet. Sec. corner West and $\frac{1}{4}$ Corner East.
- 16-Sec.4 Placed corner midway Bet. $\frac{1}{4}$ Corner West and Sec. Cor. East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" Aluminum cap at all corners, except 15-16 Sec. 4
- 8-Sec.4 Bearings: 8" J. Pine, S14°W, 13.0' and 12" J. Pine, S82°E, 11.6'.
 - 9-Sec.4 Bearings: 24" R. Pine, S80°W, 32.7' and 20" R. Pine, S7°W, 18.0'.
 - 9A-Sec.4 Bearings: 18" R. Pine, N48°W, 43.7' and 6" J. Pine, S32°E, 51.1'.
 - 15-Sec.4 Bearings: 12" R. Pine, N46°E, 44.4' and 14" R. Pine, S46°E, 21.5'.
(MONUMENT 36" T Iron.)
 - 16-Sec.4 Bearings: 8" R. Pine, S66°W, 31.0' and 6" R. Pine, S57°E, 49.7'.
(MONUMENT 1" x 45" pipe, buried.)

SIGNED BY Billy D. Buckler
Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 1/17/77

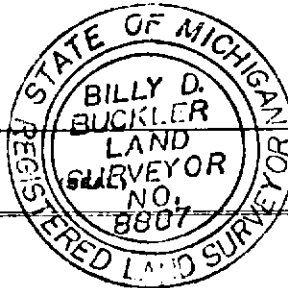

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____