## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

	Filing Requirement of Act 74, Mich. P.A. 1970 as Amended					
For corners in						
Luce	Located In:	Corner Code #				

Located In: (County) 1. Public Land Survey T 49N R 10W R Т 2. Property Controlling T R in Section S T R 3. Miscellaneous S Property in Sec.

Register of Deeds Stamp & File Number
4. Lot No. , Recorded Plat


A B C D F F G H T T F

t, Stephan J. Szyszkoski, in a field survey on 08/05/2008 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of 5

instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of 6 a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with 7 the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, 8 re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

5. Private Claims

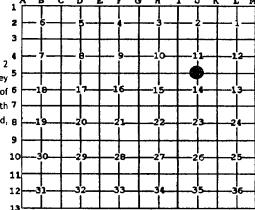

- A. Description of original monument and accessories and/or subsequent restoration:
- (J5) Quarter corner common to Sections 11-14. 1854 Established by George Cannon Deputy Surveyor midway and on the Section line between Section corners 40.00 chains east and west. Set post. Spruce Pine 6" S30W 49 links, Spruce Pine 5" N35E 16 links. 1958 Remonumented by Billy D. Buckler RLS: "Replaced corner as set by Marcus Schaaf, Reg. Surveyor. Found 2" iron pipe in place in E-W firelane, with two jackpine stump bottoms, S30W, 49 links and N35E, 16 links. Set 1" pipe with 4" brass cap. 12" White Pine S44E 27 links, 14" Red Pine N40E 83.5 links.
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- (J5) The 1958 monument was not recovered. The 2" iron pipe was not recovered. The 1958 witness trees were both recovered in good condition. At the position for the corner I found the square concrete base of the Schaaf monument with hole in center, marking the former position of the 2" iron pipe. Also found remains of sq'd wood post adjacent. The 1958 NBTs were found at record bearing and distance. Accepted the remains of the Schaaf monument as a careful and faithful perpetuation of the position of the original corner. Left the conc. base in place and drove a new monument through the hole in its center. The corner lies on the south side of an E-W firelane.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J5) Set 1"IDx36" I.pipe with plastic MDNR cap in found concrete base of previous monument. Set measuring nail with MDNR tag in the side of: 8" J.Pine S27W 9.1' mrkd "1/4S NBT" 8" R.Pine N35W 33.5' do 16" W.Pine S43E 18.55' mrkd "1/4S" 1958 NBT 20" R.Pine N43E 55.4' do do

Bearings are magnetic. Mon. set flush to grnd.

STEPHAN J.
SZYSZKOSKI
LAND
SURVEYOR
No.
33986

Signed by	There	182	7 nDyt	wsli.	Date	09/23/2008	
Surveyor's Michigan Lic	ense No.		33986		:		