

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

Two Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>49</u> N. <u>X</u> , R. <u>12</u> E. <u>W.</u>	<u>C-12, E-9</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____, R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8/7 & 10/24, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corners set by Francis Coleman, D.S. in 1851.

C-12 Quarter Corner bet. Sec's. 31-32. Bearings were: Hemlock 8", N70°W, 39 lks. and Fir 10", S37°E, 4 lks.

E-9 Sec. Cor. common to Sec's. 20-21-28-29. Bearings were: Beech 10", N41°W, 18 lks. & Sugar 12", S72°E, 15 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-12 Replaced corner from original Hemlock witness tree. Tree is still living, diameter 22".


E-9 Corner replaced from original Sugar B.T. Bearing should be S27°E, rather than the recorded "S72°E". Tree has been cut; is now 30" in diameter, inside 12" rotted out. Found imprint of scribe marks on the overgrowth.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at both corners.

C-12 New Bearings:	E-9 New Bearings:
12" Hemlock, S47°W, 28.6'	10" Maple, N29°E, 44.3'
16" Cedar, N85°E, 35.0'	16" Maple, S55°W, 32.7'
22" Hemlock, N70°W, 25.8'	8" Maple, S30°E, 34.7'
(Original)	

SIGNED BY Billy D. Buckler DATE 4-10-78
Billy D. Buckler
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

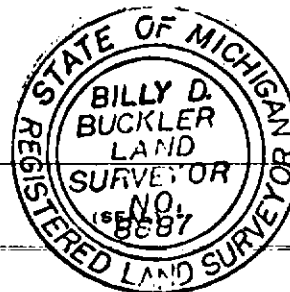

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____