

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. 50 ^{N.} _{S.} , R. 8 ^{E.} _{W.}	C-7, D-7
2. PROPERTY CONTROLLING IN SECTION_____	T. 50 ^{N.} _{S.} , R. 8 ^{E.} _{W.}	3-Sec.20
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____, R. _____ ^{N.} _{S.} , ^{E.} _{W.}	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-20, 19 80, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- C-7 Sec. Cor. 17-18-19-20, set by Wells Burt, D.S. in 1850. Bearings were:
 Y. Birch 18", S84°W, 14 lks. and Balsam 10", N60°E, 18 lks.
- D-7 Quarter Corner bet. Sec's. 17-20, set by Wells Burt, D.S. in 1850. Bearings were:
 S. Pine 8", North, 83°E, 76 lks. & Y. Pine 5", S74½°W, 91 lks.
- 3-Sec.20 North 1/16 Corner, on West side of Section 20.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-7 Placed monument at site of an old wood post with a scribed witness; a 12" W. Birch, S38°E, 8 lks. This witness has been marked about 40 years ago. Record indicates lines to North and West to descend to lake from post. This agrees with existing corner.
- D-7 Restored corner midway and on line bet. two Sec. Corner. Found an old wood post 38.0' West and 24.5' South of the corner, which was not accepted in this survey.
- 3-Sec.20 Found remains of two wood posts on ground and in the sub-soil. Position is on a straight line bet. Sec. Cor. to North and ¼ Cor. to South. Adjusted monument to be midway bet. these two corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C-7 Placed 1" pipe with 4" aluminium cap at corner. New Bearings:
 4" Red Pine, S60°E, 21.8' & 6" Red Pine, S1°E, 48.6' & 8" Red Pine, S79°W, 8.45. Corner lies on SE edge of a hilltop, which is 114' Above Lake Superior
- D-7 Placed 1" pipe with 4" aluminium cap at corner. New Bearings:
 6" J. Pine, S41°E, 6.4' & 5" Oak, N64°W, 28.2' & 8" W. Birch, S60°W, 14.6'.
- 3-Sec.20 Placed ½" x 24" Iron Rod and wood post at corner. No witnesses.

SIGNED BY Billy D. Buckler DATE 8-21-80
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

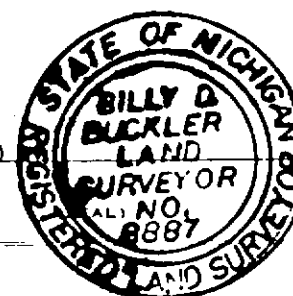

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET