

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>50</u> N. <u>8</u> E. <u>W.</u>	<u>I-6, I-7, H-7</u>
2. PROPERTY CONTROLLING IN SECTION <u>15</u>	T. <u>50</u> N. <u>8</u> E. <u>W.</u>	<u>5-Sec. 15</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 2-5 & 6-12, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 Sec. and $\frac{1}{4}$ corners set by Wells Burt, D.S. in 1850. Bearings were:

- I-6 W. Pine 36", N66°E, 16 lks. & Maple 14", S67°W, 24 lks., Quarter Corner bet. Sec's. 14-15.
- I-7 Sec. Cor. 14-15-22-23: Y. Birch 16", S64°E, 12 lks & Beech 12", N51°W, 37 lks.
- H-7 Quarter Corner bet. Section's 15-22: Fir 10", for sec. cor. and Maple 10", N89°W 11 lks.
- 5-Sec.15 North 1/16 corner of section 15.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-6 Replaced corner from W. Pine witness in good condition.
- I-7 Replaced corner at wood post (with illegible names), found old blazes in all four directions.
- H-7 Restored corner midway bet. two corners. Found line of blazes to East, West, and North. 8" Spruce, down with blazes to North of line.
- 5-Sec.15 Placed corner midway bet. center corner and the North quarter corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminum cap at all 4 corners.

- I-6 10" H. Maple, N25°W, 40.0' & 8" H. Maple, N89°W, 31.8' & 6" H. Maple, S2°W, 32.8'.
- I-7 8" S. Maple, N69°W, 24.5' & 14" S. Maple, N23°E, 62.2' & 14" S. Maple, S21°W, 22.6' & 10" S, Maple, S72°E, 22.9'.
- H-7 30" W. Pine, S85°E, 28.2' & 16" S. Maple, N52°W, 27.3' & 22" S. Maple, S17°W, 11.0'.
- 5-Sec.15 14" W. Birch, S45°E, 8.4' & 12" W. Pine, N61°W, 4.1' & 14" W. Pine, N50°E, 31.1'.


SIGNED BY _____ DATE 10-9-80

Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

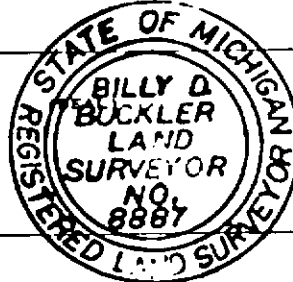

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OF ATTACHED SHEET