

FILED

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

JUL 14 9 48 AM '95

NANCY HAVILAND
REGISTER OF DEEDS
LIVINGSTON COUNTY, MI
48043

For corners in
Livingston
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 4N R 4E D-11
- T _____ R _____
- T _____ R _____
- T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
- in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
- Property in Section S _____ T _____ R _____

L.S.C.#411m
Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5			4			3		2		1
3													
4	7		6			9			10		11		12
5													
6	18		17			16			15		14		13
7													
8	19		20			21			22		23		24
9													
10	30		29			28			27		26		25
11													
12	31		32			33			34		35		36
13													

I, Edward Anderson, in a field survey on June 30, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. NOTES DATED: June 20, 1823
G.L.O. WITNESSES: W. Oak 18" N36 1/2°W 7 Lks
W. Oak 15" S29°W 32 Lks

Additional Data on Back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" capped rerod. Fit Boss and Garlock witnesses

OCT 11 1995


COMMISSION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-11 N 1/4 COR SEC 32 T4N-R4E

Set 36" x 1 1/4" Breakaway iron pipe with brass cap (Liv. Co. Mon. Cor.)
in centerline Crandall Road
N 72°E 56.55' spike W/S 24" Oak
S 37°E 51.34' spike W/S 10" Triple Maple
S 68°W 81.72' spike E/S Power Pole
N 03°W 24.29' spike E/S 36" Oak

Signed by E. Anderson
Surveyor's Michigan License No. 11495

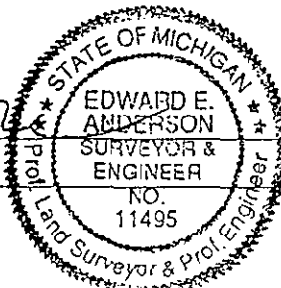

Date July 5, 1995

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

P.A. 348 1980, APPROVED BY LIVINGSTON COUNTY
FILED GROUP ON 4-5-95



401 S. Leroy St.
Fenton, Michigan 48430-2164

EDWARD E. ANDERSON, P.S., P.E.
RICHARD F. FRANK, P.S.
BRIAN R. SHALTZ, C.S.T.

Members of:
Michigan Society of Professional Surveyors
American Congress on Surveying and Mapping
American Society of Civil Engineers

(313) 629-8974
FAX (313) 629-9069

SUMMARY

March 23, 1995

D-11 NORTH 1/4 CORNER OF SECTION 32, T4N-R4E, COHOCTAH TOWNSHIP,
LIVINGSTON COUNTY, MICHIGAN.

Found 1/2" capped rerod (#30101, Shellenbarger) 16.5' east of the centerline of Crandall Road to the south and 4' north of the centerline of Chase Lake Road (all roads gravel)

Checked and measured to witnesses we found. Found 3 of 5 of Boss witnesses and they checked, pages 8, 9, and 16 this dossier. Found all of Garlock witnesses and they checked, pages 17 and 18 this dossier. Found 2 of 3 of C.H.M.P. witnesses and they checked, page 19 this dossier. Found all of Shellenbargers witnesses and they checked, pages 22 and 24 this dossier.

Distance from the North 1/4 corner to the N.E. corner of said Section 32 is 2626.98', Boss survey, page 8 this dossier; and 2627.56', Boss surveys, pages 13, 14, 15, and 20, this dossier, and 2627.57' Shellenbarger survey, page 22 this dossier.

Distance from the North 1/4 corner to the N.W. corner of said Section 32 is 2627.56', Boss surveys, pages 13, 14, 15, 19, and 20 this dossier.

Made a clean sweep of immediate area and found no other corners or irons.

Gravel roads running east, south and west. Road rises to the east, flat to the south, and falls to the west.

Terrain is open to the north and south.

Poor location for G.P.S.

Came to the conclusion that the 1/2" rerod we found is the correct North 1/4 corner of said Section 32.

Edward E. Anderson
P.S.#11495

