

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

2 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> ^{N.} S. , R. <u>6</u> ^{E.} W.	<u>J-5, K-5</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____, S., R. _____, E. _____, W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____, S., R. _____, E. _____, W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-10, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- J-5** Quarter Corner between Sec's 11-14, set by H. Brevoort Jr., D.S. in 1845.
Bearings were: Birch 8, N11°W, 23 lks. and Maple 8, S23°W, 25 lks.
- K-5** Section Corner common to Sec's 11-12-13-14, set by H. Brevoort Jr., D.S. in 1845.
Bearings were: Beech 14, S19°W, 10 lks. and Hemlock 10, N31°E, 27 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- J-5** Restored corner midway and on line between two Section Corners. Found no evidence of original corner.
- K-5** Corner re-established by Double Prop. Measure between Corners; 1 mile in all four directions. No evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at both corners.

- J-5** New Bearings: 24" W. Pine, East, 53.0' and 9" Soft Maple, S75°W, 22.3'.
- K-5** New Bearings: 9" Soft Maple, N59°E, 6.0' and 11" Soft Maple, N74°W, 19.8' and 10" Soft Maple, S9°W, 26.9'.
Corner lies South of top of a steep hill, facing South.

SIGNED BY Billy D. Buckler DATE 9-11-78
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

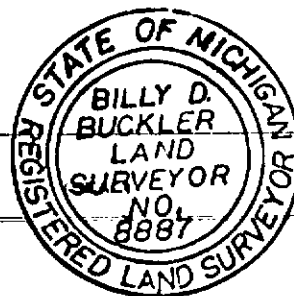

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____