

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

4 Corners.

| FOR CORNERS OF-- | LOCATED IN-- | CORNER CODE NUMBER |
|---------------------------------------|---|--------------------|
| 1. PUBLIC LAND SURVEY | T. <u>42</u> N. <u>3</u> S., R. <u>6</u> E. <u>W.</u> | B-4, C-4, B-5, A-5 |
| 2. PROPERTY CONTROLLING IN SECTION | T. _____ N. _____ S., R. _____ E. _____ W. _____ | |
| 3. MISCELLANEOUS PROPERTY IN SECTION | T. _____ N. _____ S., R. _____ E. _____ W. _____ | |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-22, 5-8, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- B-4 Center Corner of Section 7.
- C-4 1/4 Cor. bet. Sec's. 7-8, set by H. Brevoort, JR., D.S. in 1845. Bearings were: Beech 8", S4°E, 15 lks. & Beech 10", N18°E, 22 lks.
- B-5 1/4 Cor. bet. Sec's. 7-18, monumented by this Department 7-19-63.
- A-5 Sec. Cor. Bet. Sec's. 7-18, T42N R6W and Sec's. 12-13, T42N R7W.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-4 Placed corner at intersection of lines connecting opposite quarter corners. Found old blazes to East, North, and South of this location.
- C-4 Restored corner midway and on line bet. two Sec. Cors. Found no evidence of original corner.
- B-5 Re-witnessed corner. The witnesses marked in 1960 are dead.
- A-5 Re-witnessed corner and noted new bearings. 1963 witnesses were removed by road construction Found an iron buried in Center of gravel road. The original Beech corner tree has been removed.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" alum. cap at B-4 & C-4. 1" pipe with 4" Brass cap at B-5. Re-Witnessed A-5
- B-4 Bearings: 16" S. Maple, S15°E, 44.4' & 16" S. Maple, N20°E, 8.7' & 16" S. Maple, S86°W, 48.9' Corner lies on North side of a road.
- C-4 Bearings: 6" S. Maple, N11°W, 17.1' & 24" W. Pine, S15°E, 34.6' & 12" Beech, S61°E, 36.4'.
- B-5 New Bearings: 14" Beech, N69°W, 30.8' & 6" H. Maple, S85°W, 24.7'.
- A-5 Re-witnessed corner. 13" S. Maple, N20°W, 56 links in place: 6-20-60. New Bearings: 8" Beech, S54°E, 54.4' & 8" S. Maple, N49°W, 48.2'.

SIGNED BY Billy D. Buckler DATE 9-29-80
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

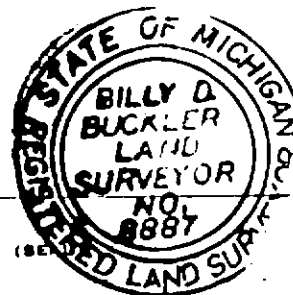

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET