

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

4 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 42 N. R. 12 W.	I-7, J-7, J-5
2. PROPERTY CONTROLLING IN SECTION-14	T. 42 N. R. 12 W.	1-Sec. 14
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

Billy D. Luckler

I, _____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 11-3 & 11-6, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section and quarter corners set by Guy C. Carlton D.S. in 1849. Bearings were:

- I-7 Sec. Cor. 14-15-22-23. Cedar 8", N59°E, & Cedar 12" S71°W, 1ks missing.
- J-7 1/4 Cor. bet. Sec's. 14-23. Cedar 12", S51°E, 12 lks. & Spruce 8", N46°W, 27 lks.
- J-5 1/4 Cor. bet. Sec's. 11-14. Tamarack 8", S33°E, 16 lks. & Tam 6", N39°W, 24 lks.
- 1-Sec. 14 West 1/16 Corner on north side of section 14.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-7 Found old squared post with numerous blazes 32 to 55 years old. Found blazes to North, South, and East and West. Cedar remains in area but none identified.
- J-7 Corner restored midway and on line bet. two sec. cors.; the sec. cor. to East is an original.
- J-5 Replaced corner from both original bearing; Tam 8, S33°E, 16 lks is still green and was only 3" when marked. The other Tam. is a rotted stump.
- 1-Sec. 14 Placed cor. midway bet. sec. cor. to West and 1/4 cor. to East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pipe with 4" aluminum cap at all corners. Bearings:

- I-7 7" Cedar, S77°W, 14.3' & 15" Y. Birch, N22°W, 20.5' & 15" Hemlock, S71°E, 59.5'.
- J-7 4" Cedar, S9°W, 10.1' & 6" Cedar, N35°W, 3.3' & 6" Cedar, East, 4.4'.
- J-5 6" Cedar, S85°W, 11.9' & 8" Cedar, N21°W, 33.3' & 7" Tam., N70°W, 4.7'.
This is a wet swamp.
- 1-Sec. 14 10" Cedar, S74°W, 5.1' & 7" H. Maple, N27°E, 48.4'.


SIGNED BY: Billy D. Luckler DATE: 2-11-81

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY: _____ DATE: _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY: _____ DATE: _____
MICHIGAN REGISTERED LAND SURVEYOR

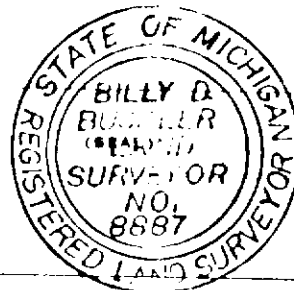

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____