LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Mackinac Corner Code # Located In: (County) 1. Public Land Survey 2. Property Controlling In Section

Register of Deeds Stamp & File Number


, Recorded Plat 4. Lot No. 5. Private Claims

3. Miscellaneous Property in Sec.

> Sep 03 1996 10 Sep 04 1996 F7

Stephan J. Szyszkoski . 19 in a field survey on requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

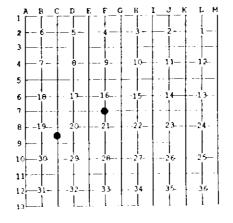

A. Description of original monument and accessories and/or subsequent restoration:

(F7) Quarter corner common to Sections 18-21. Corner reestablished in 1954 by Real Sperrake, RtS, on a straight line and midway between monumented section corners 40.155 ch. East and West. Monument placed: 1° 10 x 35° ga vanized iron pipe capped with a stamped aluminum Kimberly-Clark Corp. cap. Witnesses to corner: Tamarack 4 N55W 7 links, Spruce 5 S35E 49.5 links. (10-Sec. 20) South 1/16 corner between sections 19-20. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(F7) Recovered the 1964 manument, as described, in good condition, and at record bearing and distance from the 1964 accessories, now both dead and down. An old wooden post and a metal fence post stand adjacent to the monument. I determined the monument to be located 6.46' East and 3.3' North of the position intended in 1964 and accepted same as a careful and faithful reestablishment of the position of the corner. Left the monument in place and marked four new accessories as described below. Corner recovered and remitressed by T.Stark and D.Campela, Newberry District Office. The adjacent section corners were found 2655.5' west, and 2642.6' east. (to-Sec. 20) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Quarter corner 1309.18' north and Section corner 1309.18' south. At the position for the corner, I placed a 1'ID x 36' iron pipe capped with a 4° dia. cast aluminum MDNA tablet, appropriately stamped. Corner placed and witnessed by T.Stark and D.Lampela, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

(F7) Found (* pipe with Kimberly-Clark Corp. cap. Blazed, scribed, and set measuring nails in the following:

(10) Set 1" iron pipe with 4" MONR cap. Blazed, scribed, and set measuring nails in the following:

4' Balsar N33W 14.5' 1/45 NBT 4' Spruce N20E 15.2' "1/45 N8T" 1/45 N8T 4" Balsan N43E 10.35"

Placed a 3" squared and scribed cedar

post adjacent. An older wood post and a

16" Cedar S12E 10.8" "\$1/16 B! "\$1/16 BT" 10" Twin Cedar \$47W 27.55" 14" Cedar S06W 23.5' "\$1/18 B!"

15" Cedar NOSE 20.1' Placed a 3" squared and scribed cedar post adjacent. Bearings are magnetic. SZYSZKOSKI LAND SURVEYOR (AND SU AND SU

metal post were also found at the monument. Bearings are magnetic.

Surveyor's Michigan License No.

3' Balsar \$156 12.75' 1/48 NBT

Signed by _

For the Michigan Department of Natural Resources - Forest Management Division