

7

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

1. Public Land Survey

T 43N R 1W D7

T R _____

T R _____

T R _____

2. Property Controlling
In Section

S 20 T 43N R 1W 5

S T R _____

3. Miscellaneous
Property in Sec.

S T R _____

S T R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Sep 04 1995

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5			4			3			1
3													
4	7			8			9			10			12
5													
6	10			17			16			15			13
7													
8	19			20			21			22			24
9													
10	30			29			28			27			25
11													
12	31			32			33			34			36
13													


A. Description of original monument and accessories and/or subsequent restoration:
(D7) Quarter corner common to Sections 17-20. Corner reestablished in 1964 by Neal Sperhake, RLS, on a straight line between Section corners 40.205 ch. east and west. Corner monument: 1" Galvanized iron pipe capped with a stamped aluminum Kimberly-Clark Corp. Tablet. Witnesses to corner: Balm of Gilead N75W 10 links, do S31E 21 links.
(5-Sec. 20) North 1/16 corner, Section 20. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(D7) Found the 1964 monument, as described, in good condition. Both of the 1964 witnesses were recovered dead and down. I determined the monument to be 0.2' south and 5.5' east of the position intended in 1964 and accepted same as a careful and faithful reestablishment of the position of the corner. Left the monument in place and marked 4 new accessories as described below. Corner recovered and witnessed by T.Stark and D.Lampela, Newberry District Office.
(5-Sec. 20) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between the monumented quarter corner to the north and the unmonumented center of section to the south, the center being the intersection of straight lines connecting opposite 1/4 corners. At the position for the corner, I placed a 1"10 x 36" iron pipe capped with a 4" dia. cast aluminum WDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark and D.Lampela, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(D7) Found 1" pipe with Kimberly-Clark Corp. cap. Blazed, scribed, and set measuring nails in the following:	(5) Set 1" iron pipe with 4" WDNR cap. Blazed, scribed, and set measuring nails in the following:
7" Balsam N63E 19.95' "1/4S NBT"	5" Balsam N52W 13.3' "N1/16 BT"
6" Balsam S67E 5.15' "1/4S NBT"	6" Balsam N09E 26.3' "N1/16 BT"
6" Balsam S49E 13.25' "1/4S NBT"	6" Balsam S38E 12.45' "N1/16 BT"
6" Balsam N74W 27.65' "1/4S NBT"	6" Balsam S04E 15.7' "N1/16 BT"
Placed a 3" squared and scribed cedar post adjacent. Bearings are magnetic.	Placed a 5" squared balsam post adjacent. Bearings are magnetic.

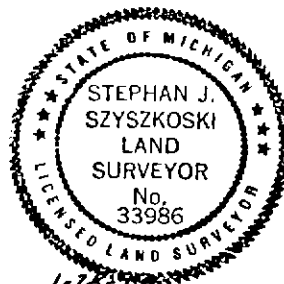

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 1-26-97

For the Michigan Department of Natural Resources - Forest Management Division