

FEB 18 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

- 1. Public Land Survey T 43NR 5W E-2
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. , Recorded Plat
5. Private Claims

RECEIVED & FILED
DIANE SPANGLER
MACKINAC COUNTY REGISTER OF DEEDS

DEC 07 1993

AM 71619101-1-41413141516

Register of Deeds Stamp & File Number

Neil E. Hill

October 1 93

I, Neil E. Hill, in a field survey on October 1, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Grid table with columns A-M and rows 2-13. A dot is marked at the intersection of column D and row 2.

A. Description of original monument and accessories and/or subsequent restoration:

1845: Corner positions were established H. Brevoort, Jr., D.S., in the original G.L.O. survey and the original G.L.O. subdivision survey of T43N, R05W; Set a wood post and established the following references: 12" S. Maple S85W 20 links 16" S. Maple S05E 28 links

1990: The USDA Forest Service found no other record of any subsequent corner restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1990: The USDA Forest Service found no original or any subsequent corner evidence. Corner position was re-established by survey on line between the Northwest and Southwest Corners of Section 4, at the intersection with an ancient fence line running East and West.

1990: The USDA Forest Service set a 1/2" by 18" long rebar with a plastic I.D. cap, buried approximately 0.5 feet below road surface. Established the following references of which the Bearing Trees are blazed, scribed, painted, and tagged: 12" R. pine N25E 107.9 feet 15" R. pine N63E 61.9 feet 15" W. spruce S71W 48.2 feet Post w/sign N90E 30.1 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


1993: Found a 1/2" rebar with a plastic I.D. cap, buried approximately 0.5 feet below road surface and verified 1990 witnesses. Additional references established: Fence anchor post N90E 36.1 feet 6 feet West of the centerline of a N-S gravel road, in the Westerly edge of gravel.

1993: Replaced with 5/8" X 30" rod with 3" diameter aluminum cap. Upon review, the location and witnesses for the corner as recorded in Liber D-0127 (Corner Records), are sufficient to perpetuate the corner location.

Signed by Neil E. Hill P.S. P.C.

Surveyor's Michigan License No. 27447

Remonumentation Surveyor

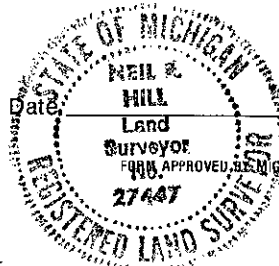

October 15, 1993

D-0235