

FEB 18 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #:

- 1. Public Land Survey T 43NR 5W F-3
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

RECEIVED & FILED
DIANE G. HONIG
MACKINAC COUNTY REGISTER OF DEEDS

DEC 07 1993

AM PM
7/8/91/10/11/12/13/14/15/16

Register of Deeds Stamp & File Number

- 4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. A dot is marked at the intersection of column F and row 3.

Neil E. Hill October 1 93

I, Neil E. Hill, in a field survey on October 1, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1845: Corner positions were established H. Brevoort, Jr., D.S., in the original G.L.D. survey of T43N, R05W. Set a wood post and established the following references: 6" S. Maple N50E 35 links 6" Birch S64W 6 links
1990: The USDA Forest Service found no other record of any subsequent corner restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- 1990: The USDA Forest Service found no original or any subsequent corner evidence. Corner position was re-established by survey on line between the Southeast and the Southwest Corners of Section 4, and on line with the intersection with and ancient fence line running North and South.
1990: The USDA Forest Service set a 1/2" by 18" long rebar, capped with a plastic I.D. cap. Top of rebar is flush with road surface. Established the following references of which the Bearing Trees are blazed, scribed, painted, and tagged: Utility pole N69E 109.8 feet 18" Maple S32E 75.7 feet 14" Maple S22W 81.0 feet Post w/sign S00E 25.0 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1993: Found a 1/2" rebar, capped with a plastic I.D. cap and verified 1990 witnesses. Established additional references: Fence anchor post 47 feet North, 4 feet South of bituminous road centerline.
1993: Replaced with 5/8" X 30" rod with 3" diameter aluminum cap. Upon review, the location and witnesses for the corner as recorded in Liber D-0129 (Corner Records), are sufficient to perpetuate the corner location.

Signed by Neil E. Hill R.S. P.C. 27447

Surveyor's Michigan License No. Remonumentation Surveyor

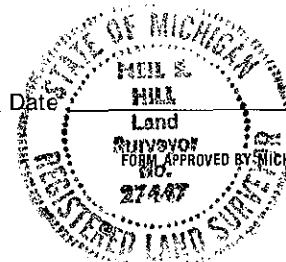

October 15, 1993

D-0237