

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970  
Mackinac Co. 3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY-----	T. <u>43</u> N. <u>X</u> , R. <u>6</u> W.	J-9, G-12, I-7
2. PROPERTY CONTROLLING IN SECTION-----	T. _____ N. _____ S. R. _____ E. _____ W.	-----
3. MISCELLANEOUS PROPERTY IN SECTION-----	T. _____ N. _____ S. R. _____ E. _____ W.	-----
4. LOT NO.-----, RECORDED PLAT-----	-----	-----
5. PRIVATE CLAIMS-----	-----	-----

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6/10 & 7/12, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

All corners set by H. Brevoort Jr., D.S. in 1845.

J-9 $\frac{1}{4}$ Cor. bet. Sec's. 23-26. Bearings were: B. Ash 12, S81°E, 41 lks. Birch 8, N71°E, 27 lks.	G-12 $\frac{1}{4}$ Cor. bet. Sec's. 33-34. Bearings were: A Balsam 18" for corner. No other witnesses.	I-7 Sec. Cor. 14-15-22-23. Bearings were: Cedar 8, S61°E, 20 lks. Cedar 8, S43°W, 23½ lks.
---	---	---

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


J-9 Re-witnessed corner found by Marcus Schaaf R.L.S. 1937. Found 1½" iron pipe. Old witnesses are obliterated. Corner lies 80' South of East-West road.  
 G-12 Re-monumented a corner set by unknown surveyor about 1942. Found two trees scribed as witnesses. 18" Hemlock, S30°E, 6.8' and 16" Red Maple, N46°E, 7.0'. Both trees scribed "¼S NBT". Position checks well with other corners in area.  
 I-7 Replaced corner from both original witnesses: SE tree is standing: SW tree is down.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-9 re-witnessed corner. G-12 and I-7 placed 1" pipe with 4" aluminium cap.

J-9 New Bearings: 24" W. Pine, N5°W, 43.9' 18" R. Pine, S15°W, 75.3'	G-12 New Bearings: Marked one new bearing: 8" Hemlock, N48°W, 3.0'	I-7 New Bearings: 6" Cedar, N40°W, 4.7' 6" Cedar, S10°E, 17.6'
--	--	--

SIGNED BY Billy D. Buckler DATE 9/19/77  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

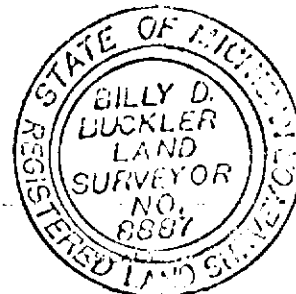

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_