

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
 Mackinac Co. 3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. <u>43</u> N. R. <u>6</u> W.	K-9, I-5, E-11
2. PROPERTY CONTROLLING IN SECTION.....	T. _____ N. S. R. _____ E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS.....		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8/2-16-18/, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
All corners set by H. Brevoort Jr. D.S. in 1845.

K-9 Sec. Cor. 23-24-25-26. Bearings were: Balsam 8, S69°E, 22 lks. Balsam 9, S41°W, 30 lks.	I-5 Sec. Cor. 10-11-14-15. New Bearings: Hemlock 16, S42°E, 22 lks. Hemlock 14, N48°W, 14 lks.	E-11 Sec. Cor. 28-29-32-33. Bearings were: Tam. 4", S3°E, 17 lks. Tam. 4", N12°W, 15 lks.
--	---	--

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

K-9 Found 2" iron pipe set by Marcus Schaaf, R.L.S. 1937. Found W. Pine stumps noted as witnesses by Schaaf. His notes indicate this corner was set from corners East and South and Line Trees North and West.

I-5 Corner replaced from one original witness; Hem. 16", S42°E, 22 lks. Found post set by Marcus Schaaf, R.L.S. in 1937.


E-11 Found wood post, set by Marcus Schaaf, R.L.S. Found no evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-9 re-witnessed 2" iron pipe. I-5 and E-11 placed 1" pipe with 4" aluminum cap at corners.

K-9 New Bearings: 11" R. Pine, N48°W, 7.6' 8" R. Pine, N88°E, 10.0' 7" R. Pine, S5°E, 2.2' Cor. lies in R. Pine plantation, 220' West and 100' South of Road intersection.	I-5 New Bearings: 10" Spruce, N82°E, 11.8' 6" Spruce, N44°W, 18.5'	E-11 New bearings: 10" W. Pine, N51°W, 39.5' 12" W. Pine, N30°E, 36.4'
--	--	--

SIGNED BY Billy D. Buckler DATE 9/19/77
 Billy D. Buckler 8887
 SURVEYOR'S MICHIGAN REGISTRATION NO. _____

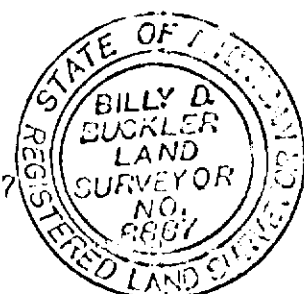

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)