

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

| FOR CORNERS OF-- | LOCATED IN-- | CORNER CODE NUMBER |
|---------------------------------------|---|--------------------|
| 1. PUBLIC LAND SURVEY | T. <u>43</u> N. <u>6</u> R. <u>X</u> W. | C-5, C-4, D-11 |
| 2. PROPERTY CONTROLLING IN SECTION | T. _____ N. _____ R. _____ W. _____ | _____ |
| 3. MISCELLANEOUS PROPERTY IN SECTION | T. _____ N. _____ R. _____ W. _____ | _____ |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9/16, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
All Corners set by H. Brevoort Jr., D.S. in 1849.

| | | |
|---|--|--|
| C-5 Sec. Cor. 7-8-17-18. Bearings were: Beech 8, N14°W, 35 lks. Beech 8, N39°E, 45 lks. | C-4 ¼ Cor. Bet. Sec's. 7-8. Bearings were: Tamarack 4, S76°E, 13 lks. Spruce 8, N18°W, 22 lks. | D-11 ¼ Cor. Bet. Sec's 29-32. Bearings were: Tam. 6, N12°W, 16 lks. Tam. 4, S80°E, 10 lks. |
|---|--|--|

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-5 Re-established corner facing an old face on a Hemlock tree. Appears to be on an old blazed line North-South. Found no evidence of corner. Corner lies approx. record distance from corners to East.


C-4 Placed corner at record distance North of Sec. Cor. 7-8-17-18. Found no evidence of original corner. We find no open swamp as notes indicate. Timber in entire surrounding area is older than the original survey. Believe this corner was never set.

D-11 Re-established cor. midway bet. two sec. Cors. Found no evidence of cor. I doubt this cor. was set, as recorded. Area is pure hardwood; no tamaracks; and we find no stream on the East ½ mile as recorded.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Placed 1" pipe with 4" aluminium cap at all corners.

| | | |
|--|--|---|
| C-5 New Bearings: 6" Maple, N19°W, 32.5' 10" Maple, S37°W, 19.2' 10" Maple, S24°E, 19.3' | C-4 New Bearings: 8" Cedar, N72°W, 15.3' 10" Cedar, N53°E, 15.3' 20" Hemlock, S27°E, 30.1' | D-11 New Bearings: 8" Hemlock, N32°E, 26.6' 10" Hemlock, S62°E, 25.5' 12" Hemlock, S42°W, 50.8' |
|--|--|---|

SIGNED BY Billy D. Buckler DATE 9/19/77
 Billy D. Buckley
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

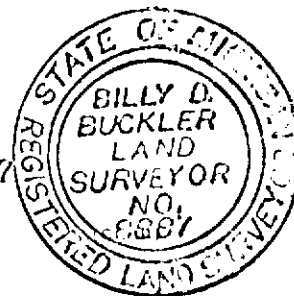

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____