

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

3 Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> <sup>N.</sup> <del>S.</del> , R. <u>6</u> <sup>E.</sup> <del>W.</del>	<u>L-3, J-11, I-8</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____, S., R. _____, E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____, S., R. _____, E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9/22 & 10/6, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
All corners set by H. Brevoort Jr. in 1845.

**L-3** Quarter corner bet. Sec's 1 and 12. Bearings were: A Y. Pine 18" for corner tree.

**J-11** Quarter corner bet. 26 - 35. Bearings were: Pine 16", S46°W, 21 lks and Hemlock 16", N45°W, 30 lks.

**I-8** Quarter corner bet. 22 - 23. Bearings were: Beech 10", S47°E, 19 lks and Maple 6", N34°W, 12 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

**J-11** Re-established corner midway and on line bet. two section corners. Found no evidence of original corner.

**L-3** Re-placed corner at a Y. Pine stump, probable corner tree. No other Y. Pine stump near. Position fits with sec. cor. west and pond to west.

**I-8** Re-established corner midway between two section corners. Found no evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
Placed 1" pipe with 4" aluminium cap at all corners.

<p><b>L-3</b> New bearings:</p> <p>10" Red Pine, S34°W, 45.0'</p> <p>8" Jack Pine, N54°W, 21.8'</p> <p>7" Jack Pine, S70°E, 10.3'</p>	<p><b>J-11</b> New Bearings:</p> <p>8" R. Pine, N23°W, 31.8'</p> <p>6" R. Pine, S77°W, 37.6'</p> <p>20" W. Pine, S45°E, 33.0'</p>
---	---


**I-8** New bearings:

10" Maple, N18°W, 18.9'

10" Maple, S50°W, 9.3'

12" Maple, S22°E, 37.3'

SIGNED BY Billy D. Buckler DATE 4-10-78  
Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

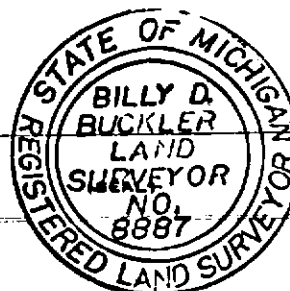

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_