

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
 Mackinac Co. 3 Corners.

FOR CORNERS OF --	LOCATED IN --	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> ^{N.} / _{S.} , R. <u>6</u> ^{E.} / _{W.}	<u>I-11, I-10, I-12</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, N. _____, S. _____, R. _____, E. _____, W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, N. _____, S. _____, R. _____, E. _____, W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 12-12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 Corners placed by H. Brevoort Jr., D.S. in 1845.

- I-11 Sec. Cor. 26-27-34-35, Bearings were: Tam 6, S11°W, 13 lks & Tam 6, N81°E, 26½ lks.
- I-10 1/4 Cor. bet. Sec's 26-27, Bearings were: Tam 12, S20°W, 4 lks. and Tam 6, S44°E, 22 lks.
- I-12 1/4 Cor. bet. Sec's 34-35, Bearings were: Maple 6, S11°W, 32 lks. and Hemlock 6, N27°E, 21 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-11 Replaced corner found by Marcus Schaaf, R.L.S. in 1937. Found remains of both witnesses; a wood post, according to Schaaf's field notes.
- I-10 Restored corner midway and on line between two Section Corners.
- I-12 Restored corner midway and on line between two Section Corners. Found no evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Placed 1" pipe with 4" aluminium cap at all corners.

- I-11 New Bearings: 6" Cedar, N39°W, 9.8' & 14" W. Pine, N50°E, 32.6' & 6" Cedar, S60°E, 26.8'. Corner lies NE of a small stream.
- I-10 New Bearings: 6" Tamarack, N63°E, 45.9' & 6" Tamarack, N27°W, 37.8' and 6" Tamarack, S27°E, 30.0'.
- I-12 New Bearings: 16" W. Pine, S62°W, 38.0' & 8" W. Pine, N19°W, 5.1' and 14" W. Pine, N75°E, 46.1'.

SIGNED BY Billy D. Buckler DATE 2-16-79
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

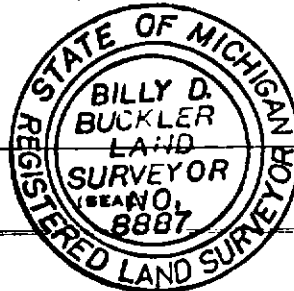

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____