

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970**

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>6</u> E. R. <u>6</u> <del>E</del> <del>W</del>	<u>E-7</u> <u>E-5</u>
2. PROPERTY CONTROLLING IN SECTION <u>16</u>	, T. <u>43</u> N. <u>6</u> E. R. <u>6</u> <del>E</del> <del>W</del>	<u>3-Sec. 16</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ E. S., R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 12-7 & 12-12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- E-7**      Sec. Cor. 16-17-20-21, set by H. Brevoort Jr., D.S. in 1845. Bearings were: Tam. 10, N43°E, 5 lks. and Cedar 4, S55°E, 20 lks.
- E-5**      Sec. Cor. 8-9-16-17, set by H. Brevoort Jr., D.S. in 1845. Bearings were: Cedar 3, S63°E, 89 lks. and Cedar 8, N89°W, 88 lks.
- 3-Sec.16** North 1/16 Corner on West side of Section 16.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**


- E-7**      Restored Sec. Cor. by single proportionate measure bet. corners 1/2 mile North and one mile South and record distance from a good corner 1/2 mile East. Found no evidence of original corner.
- E-5**      Corner replaced at an old wood post set by unknown surveyor about 50 years ago. Found old blazes along line to South.
- 3-Sec.16** Placed corner midway and on line between Sec. Cor. to North and 1/4 Cor. to South.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Placed 1" pipe with 4" aluminium cap at all corners.
- E-7**      New Bearings: 10" Cedar, N40°E, 21.5' and 12" Cedar, N61°W, 28.6'.
  - E-5**      New Bearings: 8" Cedar, N30°E, 12.7' & 10" Cedar, S40°W, 29.3' and 14" Cedar, N38°W, 21.8'.
  - 3-Sec.16** Bearings: 6" B. Spruce, S50°E, 38.2' & 6" Tamarack, N57°W, 17.0' and 4" Tamarack, N29°E, 33.4'.

SIGNED BY Billy D. Buckler      DATE 2-16-79  
 Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

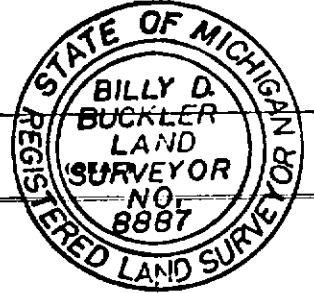

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_