

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>X</u> , R. <u>8</u> E. <u>W.</u>	<u>B-7</u>
2. PROPERTY CONTROLLING IN SECTION <u>19</u>	T. <u>43</u> N. <u>X</u> , R. <u>8</u> E. <u>W.</u>	<u>2-Sec.19</u> <u>1-Sec.19</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. <u>W.</u>	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- B-7** Quarter Corner between Section's 18-19, set by H. Brevoort Jr., D.S. in 1845. Bearings were: Maple 12, S61°E, 06 lks. and Cherry 3, N64°E, 10 lks.
- 2-Sec.19** East 1/16 Corner on North side of Section 19.
- 1-Sec.19** West 1/16 Corner on North side of Section 19.


**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- B-7** Restored corner midway and on line between two Section Corners.
- 2-Sec.19** Placed corner midway and on line between 1/4 corner to West and Sec. Cor. to East.
- 1-Sec.19** Placed corner midway between 1/4 corner to East and Sec. Cor. to West.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Placed 1" pipe with 4" aluminium cap at all corners.
- B-7** New Bearings: 12" Y. Birch, N31°E, 14.9' and 8" Maple, S75°E, 9.25' and 10" Maple, S68°W, 20.4'.
  - 2-Sec.19** Bearings: 8" H. Maple, S64°W, 32.7' and 10" H. Maple, S10°E, 46.4'.
  - 1-Sec.19** Bearings: 12" R. Maple, S85°E, 14.6' and 16" Beech, S11°E, 32.7'.

SIGNED BY Billy D. Buckler DATE 2-23-79  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

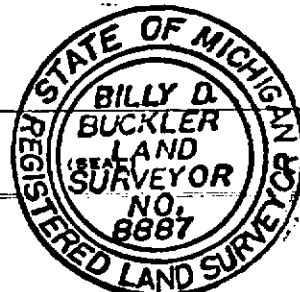

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_