

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

6 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>43</u> N. <del>X</del> , R. <u>8</u> <del>X</del> W.	I-3, B-9
2. PROPERTY CONTROLLING IN SECTION <u>30</u>	, T. <u>43</u> N. <del>X</del> , R. <u>8</u> <del>X</del> W.	B-10A, 11A-Sec.30 5-Sec.30, 6-Sec.30
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____, R. _____ E. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 12-14-76 & 4-16-68, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- I-3 Sec. Cor. common to Sec's. 2-3-10-11, set by original surveyor about 1845.
- B-9 Quarter Corner bet. Sec's. 19-30, set by original surveyor about 1845.
- Bearings were: I-3 Cedar 6, S31°E, 22 lks. and Cedar 6, N18°E, 23 lks. B-9 Birch 10, S18°W, 12 lks. & Birch 10, N52°W, 05 lks.
- 5-Sec.30 North 1/16 Corner of Section 30.
- 6-Sec.30 North-East 1/16 Corner of Section 30.
- B-10A Meander Corner on Lake Michigan, 212.3' South of Center Corner Section 30.
- 11A-Sec.30 Meander Corner on Lake Michigan, 435.9' South of West 1/16 Corner.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-3 This corner replaced at an old wood post, probably set by Marcus Schaaf, R.L.S. in 1939. Found remains of original witnesses, bearing N18°E, 23 lks. and S31°E, 22 links. Both are cedars, fallen down but with both faces and some scribe marks in evidence.
- B-9 Corner re-established by single prop. meas. bet. two Sec. Cors.
- 5-Sec.30 Corner placed midway bet. Center Cor. to South and  $\frac{1}{4}$  Corner to North.
- 6-Sec.30 Corner placed at intersection of lines quartering the NE  $\frac{1}{4}$  section.
- B-10A Placed M.C. on North-South  $\frac{1}{4}$  line in timber edge of Lake Michigan's North shore.
- 11A-Sec.30 Placed M.C. on West 1/16 line, on North shore of Lake Michigan

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminum cap at all corners.
- I-3 New Bearings: 6" Cedar, N33°E, 12.2' and 10" Cedar, S20°W, 12.1'.
- B-9 New Bearings: 16" W. Pine, N75°E, 53.1' and 8" R. Maple, N86°W, 70.5'.
- 5-Sec.30 Bearings: 6" W. Birch, N55°W, 24.15' and 4" Cedar, S34°E, 65.0'.
- 6-Sec.30 Bearings: 8" Cedar, S61°E, 30.1' and 6" Cedar, N70°E, 22.8'.
- B-10A Bearings: 10" W. Pine, S60°E, 2.6' and 6" Twin W. Pine, N8°W, 15.2'.
- 11A-Sec.30 Bearings: 12" W. Pine, S45°E, 9.9' and 8" W. Pine, N42°W, 10.7'.

SIGNED BY Billy D. Buckler DATE 1-28-77  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

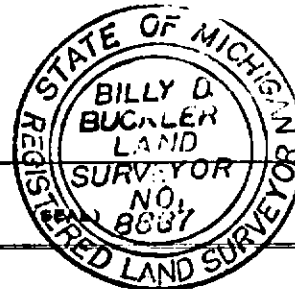

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_