

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A.1970**

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. S., R. <u>8</u> E. W.	G-11, F-10
2. PROPERTY CONTROLLING IN SECTION <u>28</u>	, T. <u>43</u> N. S., R. <u>8</u> E. W.	12-Sec.28
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-8, 5-20, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- G-11 Sec. Cor. for Sec's. 27-28-33-34, set by H. Brevoort Jr. D.S. in 1845. Bearings were: Birch 10", S70°E, 12 lks. and Hemlock 14", N28°W, 15 lks.
- F-10 Center Corner, Section 28.
- 12-Sec.28 South 1/16 Corner, Section 28.


**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- G-11 Replaced corner from one Hemlock witness tree, down, badly rotted, bearing N28°W, 15 lk and on the East side of a 12" Pine Stump, which has blazes on all four sides, some dating back to the time of the original survey. Found old blazes to North and South of here. Swamp edges check well.
- F-10 Placed corner at intersection of lines, connecting opposite quarter corners.
- 12-Sec.28 Placed corner midway bet. Center Corner and the South 1/4 Corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Placed 1" pipe with 4" aluminum cap at all corners.
- G-11 New Bearings: 6" S. Maple, N60°E, 41.6' & 8" S. Maple, S83°W, 15.5'. Corner is 2.6' East of Pine Stub, on West point of a ridge.
- F-10 Bearings: 10" Cedar, N31°W, 51.3' & 7" Cedar, N72°E, 49.6'.
- 12-Sec.28 Bearings: 7" W. Pine, S32°E, 12.6' & 16" W. Pine, N40°E, 75.2'.

SIGNED BY Billy D. Buckler DATE 9-29-80  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

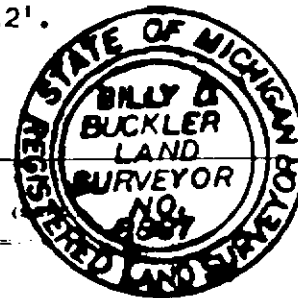

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_