

82

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Mackinac

(County)

Located in:

Corner Code #

1. Public Land Survey

T ___ R ___

T ___ R ___

T ___ R ___

T ___ R ___

2. Property Controlling
in Section

S 2 T 43N R 8W 6

S 2 T 43N R 8W 5

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___

S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Aug 28 1995

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1										●	●		
2	6		5		4		3			2		1	
3													
4	7		8		9		10			11		12	
5													
6	18		17		16		15			14		13	
7													
8	19		20		21		22			23		24	
9													
10	30		29		28		27			26		25	
11													
12	31		32		33		34			35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
(6-Sec. 2) Northeast 1/16 corner, Section 2. Corner not established in the original survey. Found no subsequent record.
(5-Sec. 2) North 1/16 corner, Section 2. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(6-Sec. 2) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners 1345.92' north, 1319.29' south, 1318.12' east, and 1317.98' west. The corners to the north and west are monumented. At the position for the corner I placed a 1"IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(5-Sec. 2) Found no evidence of prior monumentation at the corner position. Established the corner at 20 chains, proportionate to the original record, north of the Center of Section 2 and on a straight line between the center and the Quarter corner common to Section 2 T43N-R8W and Section 35 T44N-R8W. The Center of Section is 1327.70' south and the Quarter corner 1351.27' north. At the position for the corner, I placed a 1"IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(6) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails in the following bearing trees:
14" R. Pine N31E 20.15' "NE1/16 BT"
16" R. Pine S74W 4.5'
14" R. Pine S75E 12.05'
14" R. Pine S13E 16.35'
Placed a 4" squared and scribed cedar post adjacent. Center of road is west 18'. Bearings are magnetic.

(5) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails in the following bearing trees:
10" R. Pine S33E 77.7' "N1/16 BT"
3" Elm N67W 21.2'
7" Cherry N38E 11.7'
5" R. Pine S50E 17.1'
Placed a 4" squared and scribed cedar post adjacent. Bearings are magnetic.

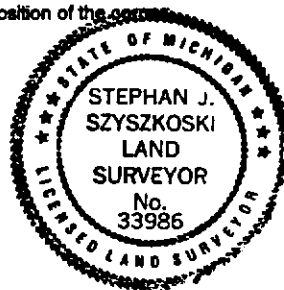

Signed by

Stephan J. Szyszkoski

Date

11-28-95

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division