

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Mackinac

(County)

Located In:

Corner Code #

1. Public Land Survey

T 43N R 9N 17

T R

T R

T R

**2. Property Controlling
 in Section**

S 14 T 43N R 9N 16

S T R

**3. Miscellaneous
 Property in Sec.**

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

May 09 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(17) Corner common to Sections 14-15-22-23. Original corner position perpetuated in 1958 by Billy D. Buckler, RLS: "Replaced from yellow birch bearing tree, bearing S28W 33 links. Found hemlock bearing tree as recorded by Schaff N42 1/2W 21 links. No record of this tree in original notes. Shown to us by J. Halbach, District Forester. Description of corner monument: 1"x48" iron pipe buried in Int. of fire lanes E-W and N. Witnesses to Corner: 8" Cedar S53E 29 links, 7" Hemlock S70W 62 links".
 (16-Sec. 14) East 1/16 corner between sections 14-23. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(17) Recovered the 1958 monument as described, in good condition 18" below present ground surface. Both of the 1958 witnesses have been removed during clearing for pipe and power lines. Left the monument in place and marked four new accessories as described below. Corner recovered and re-witnessed by T.Stark and M.Feldpausch, Newberry District Office.
 (16-Sec. 14) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1327.50' West and Section corner 1327.50' East. At the position for the corner, I placed a 1" I.D. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. I buried the monument at the corner, which falls in the center of an E-W trail. Corner placed and witnessed by T.Stark and M.Feldpausch, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(17) Found 1" dia. iron pipe, buried.
 Blazed, scribed, and set measuring nails in the following:
 14" Hemlock N23E 77.2' "S14 NBT"
 12" Y. Birch S09E 74.0' "S23 NBT"
 5" Y. Birch S45W 76.8' "S22 NBT"
 Placed nail and tag in Power Pole C/469 S39W 17.8'.
 Placed cedar post adjacent to corner.
 Bearings are magnetic.

(16) Set 1" pipe with 4" MDNR cap.
 Blazed, scribed, and set measuring nails in the following:
 6" White Pine S28E 25.1' "E1/16 BT"
 8" Twin Maple S01E 33.2' "E1/16 BT"
 4" Twin Maple S32W 22.1' "E1/16 BT"
 12" Y. Birch in clump S56W 18.0' do
 Bearings are magnetic.

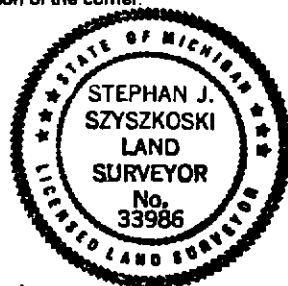

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/11/98

For the Michigan Department of Natural Resources - Forest Management Division