Filing Requirement of Act 74, Mich. P.A. 1970

For comers in Mackinac Located In: Corner Code # 1. Public Land Survey 2. Property Controlling in Section 3. Miscellaneous


Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat 5. Private Claims

Property in Sec.

Stephan J. Szyszkoski in a field survey on 19 do hereby state that under requirements of P.A. 74. Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformence with regula lions and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

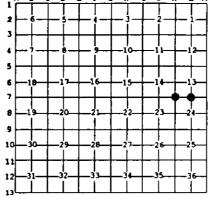

A. Description of original monument and accessories and/or subsequent restoration:
(K7) Corner common to Sections 13-14-23-24. Corner perpetuated at a local position in 1962 by Billy D. Buckler, RLS: "This corner was established in intersection of fire lines in all four directions. Found no evidence of original corner but believe fire lines were located by Marcus Schaaf, Registered Land Surveyor. Corner monument 1" pipe with 4" aluminum cap (buried). Mitnesses to corner, 6" Y. Birch M66W 82 links, 6" Hard Maple S39E 56 links".

(17) Quarter corner common to Sections 13-24. Corner established in 1849 by Milliam Ives: "40.00 set quarter section post. White Birch 10 N55E 13, Fir 10 S5E 08". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K7) Recovered the 1962 monument, as described, a 1" ID iron pipe capped with a 4" dia. Michigan Dept. of Conservation tablet, in good condition, buried in the intersection of fire lines, and at record bearing and distance from both of Buckler's 1962 MBT's, found in good condition. Re-marked the top blaze on the 1962 witnesses, and marked two new accessories as described below. Corner recovered and rewitnessed by T.Stark, Newberry District Office.

(LT) Original post and accessories were not recovered. I found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between monumented section corners 2679.00' east and west. At the position for the corner, I placed a 1" I.D. x 36" iron gipe capped with a 4" dia. cast aluminum MONR tablet, appropriately stamped. The center of an E-N trail is 23.5' south of the corner monumented. Corner placed and witnessed by T.Stark, Newberry District Office.

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner (X7) Found buried 1 iron pipe with 4 (L7) Set 1 pipe with 4 MDWR cap.

aluminum cap. Blazed, scribed, and set Blazed, scribed, and set measuring nails measuring nails in the following: in the following: B" Y. Birch N60W 59.9" "S14" 5" Balsam N72W 11.1' "1/4S HBT" 10" Maple S32E 37.2' *S24* 4" Balsam NOBW 9.9' "1/45 NBT" "1/45 MBT" 10" Beach \$38W 28.5" "\$23 NBT" 16" Maple SBOE 51.0' "S13 MBT" 4" Twin Cherry S17W 9.15" "1/4S NBT" 6" Maple MSBE 31.2' Bearings are magnetic. Placed location Placed a 4" cedar fence post adjacent. post \$40E approx. 33'. Bearings are magnetic.

4-15-98

For the Michigan Department of Natural Resources - Forest Management Division

STEPHAN

SZYSZKOSKI

LAND

SZIRVEYOR