

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>W.</u> R. <u>10</u> E. <u>W.</u>	A-5, A-6, A-7
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-10, 19 80, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
Corners placed by Wm A. Burt D.S., in 1841 and 1849. Bearings are:


- A-5 Sec. Cor. 7-18, T43N R10W and Sec's. 12-13, T43N R11W. Sugar 8", S30°E, 60 lks. & Sugar 12" N65°E, 32 lks.
- A-6 1/4 Cor. bet. Sec's. 18, T43N R10W and Sec. 13, T43N R11W: Hemlock 8", S72°W, 13 lks & Hemlock 9", N71°E, 11 lks.
- A-7 Sec. Cor. 18-19, T43N R10W and Sec's. 13-24, T43N R11W: Cedar 7", <sup>S37°W</sup> 27 lks & Cedar 10", S61°E, 15 lks. & Cedar 8", N33°E, 9 lks.

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- A-5 Witnessed and am recording corner as we found it. Corner is in line with an old fence to South.
  - A-6 Corner restored by single prop. meas. from corners 1/2 mile to North and South. Found several Hemlock remains but nothing could be identified.
  - A-7 Placed corner at an old wood post set by unknown parties. Numerous blades in all directions. Many Cedar remains but none could be identified.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- A-5 Found 3/4" Iron buried in center of E-W Road, 4" below surface. New Bearings: 14" Elm, S61°W, 42.2' and 8" H. Maple, S21°W, 22.5'.
  - A-6 Placed 1" pipe with 4" aluminum cap at corner. New Bearings: 14" Cedar, S85°W, 61.5' & 18" Hemlock, S60°E, 39.9' & 10" Hemlock, N48°E, 24.2'.
  - A-7 Placed 1" pipe with 4" aluminum cap at corner. New Bearings: 16" Cedar, N80°W, 24.0' & 8" Cedar, N3°E, 34.0' & 10" Cedar, N54°E, 25.4'. Corner lies in Cedar swamp on N-S cut line and 30' North of a power line clearing.

SIGNED BY \_\_\_\_\_ DATE 10-9-80

Billy D. Buckler  
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

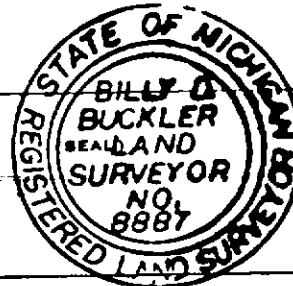

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET