

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. S. R. <u>10</u> E. W.	C-8, C-7, B-7
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-10 & 7-31, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Wm Ives, D.S. in 1849. Bearings were:

- C-8 1/4 Cor. bet. Sec's. 19-20: Hemlock 12", S18°E, 13 lks. & Y. Birch 8", N30°W, 15 lks.
- C-7 Sec. Cor. 17-18-19-20: Fir 6", N68°W, 24 lks & Fir 12", S47°E, 29 lks.
- B-7 1/4 Cor. bet. Sec's. 18-19: Hemlock 22", N23°E, 7 lks & Y. Birch 14", S35°W, 20 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- C-8 Found 1/2" pipe as set by unknown parties. This corner located by M.S.H.D. Land Surveyor, John Smallwood.
- C-7 Witnessed corner placed by the M.S.H.D. Corner fits well with corners in all four directions.
- B-7 Restored corner by double prop. measure, bet. two sec. cors. Found no evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C-8 Re-witnessed corner as accepted by the M.S.H.D. New Bearings: 10" H. Maple, S54°W, 86.1'. Corner lies at intersection of East and South roads.
- C-7 Brass cap buried in center of N-S gravel road. New Bearings: 4" W. Birch, S15°E, 76.5' & 6" Aspen, S83°W, 53.1' & 8" Aspen, N77°E, 38.9'.
- B-7 Placed 1" pipe with 4" aluminum cap at corner. New Bearings: 7" H. Maple, N20°E, 28.9' & 7" H. Maple, N45°W, 25.1' & 9" H. Maple, S11°W, 65.5'.

SIGNED BY _____ DATE 10-9-80

Billy D. Buckler
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

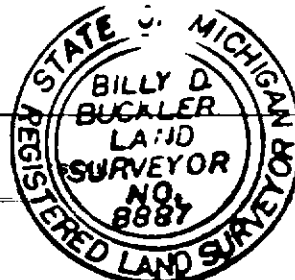

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____